

# Mill One V2 Assembly Manual

Throughout this policy the words "we", "us" and "our", or "Sienci Labs" will be used to refer to Sienci Labs Inc. herein and "Mill One" or "machine" will refer to Sienci Labs' Sienci Mill One product. Additionally, the words "you", "your", "user", and "operator" will refer to the original purchaser/customer, user, or viewer of any of the products or media provided by or through Sienci Labs.

## Machine Disclaimer

The listed "Safety Warnings and Guidelines" outline the necessary precautions that should be taken any time the machine is operated. By assembling our provided kit, the product user takes on all the associated liability pertaining to the operation and maintenance of the Mill One. Sienci Labs will not be held responsible for any damages to property or injury incurred on the operator or bystanders if any alterations are made to the design or assembly of our machine. Although care is taken to ensure the accuracy of information made available on our website ([www.Sienci.com](http://www.Sienci.com)) and other forms of media, Sienci Labs will not be held liable for any inaccuracies, errors, or inconsistencies in website content, the content of files linked to by our website, references made to external websites herein, and/or other information produced by Sienci Labs. The information which has been made available will not be applicable to all situations and is subject to change without notice so it should not substitute for the discretion of the user. Variability in machine accuracy and performance may occur due to improper machine assembly by the user, as such, Sienci Labs takes on no responsibility for variation between claimed machine specifications and the performance of the user's machine from improper assembly.

## Safety Warnings and Guidelines

1. Be sure to carefully follow provided machine assembly instructions before machine use to ensure operator safety.
2. All wires must be appropriately positioned before beginning the operation of this machine. Cutting a "live" wire may cause exposed metal parts of the routing/trimming tool to become electrified and shock the operator.
3. Ensure the machine is placed on a flat surface and in a well-ventilated space before operation.
4. Always wear eye protection during machine operation.
5. Always wear hearing protection during extended machine operation based on proximity to machine.
6. Materials may release chemicals that are toxic or unsafe to inhale when cut. Always check the Material Safety Data Sheet (MSDS) of the material in question before cutting. Always cover exposed skin and wear appropriate airway protection (e.g. dust mask/respirator) specific to the material used and its application.
7. Any workpiece must be appropriately secured before starting a cutting routine by clamps or other practical securing method. Holding the material by hand or employing any other unstable form of securing will lead to unsafe loss of machine control.
8. Cutting bits used for the Mill One should be used at the discretion of the user. Bits are sharp and can crack and break without notice so appropriate care should be taken by the user while manipulating and installing them. Carefully check bits for cracks or damage before operating the machine and replace any cracked or unfit bits immediately.
9. Carefully inspect any consumable material before use on the machine, any unforeseen inconsistency in material hardness or material quality may cause damage to the machine.
10. Keep away from all moving parts during machine operation.
11. Before beginning a cutting job, ensure the router/trimmer runs properly. Immediately disable the tool if visible vibration or wobble occurs. This might indicate a damaged tool or an improperly installed bit.
12. Make sure the bit is not contacting the workpiece before the router/trimmer tool is turned on.
13. Do not leave the machine running unattended, the machine should only be operated with the operator present.
14. Do not touch the cutting bit immediately after use. It may be hot and could burn the operator.
15. Use bits that are appropriate to the material and cutting speed used.

# LIST OF PARTS



M3-8  
24x



 
M5-N  
10x



M5-NE  
6x




M5-W  
12x




M5-25  
16x



 
M8-N  
10x




M8-15  
28x

 


M8-25  
10x

 


SC  
3x

 

A-N  
3x

 


VW  
12x

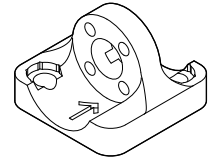

P-NH  
3x




P-AM  
5x

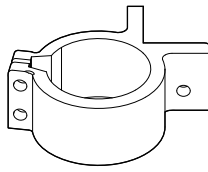


P-RM  
1x



 
P-RB  
1x




RO  
1x

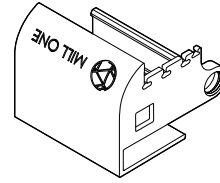


P-EH  
1x

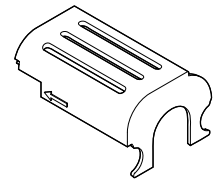


P-EC  
1x

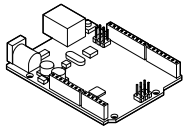

E-ARD  
1x

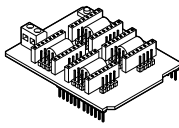

E-CNC  
1x

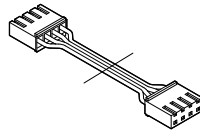


E-C  
3x




E-HJ  
6x



 
E-SDH  
3x




E-SDC  
3x

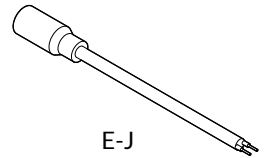


E-J  
1x

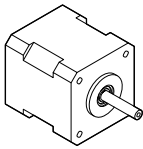


SM  
3x

 


M-FB  
8x

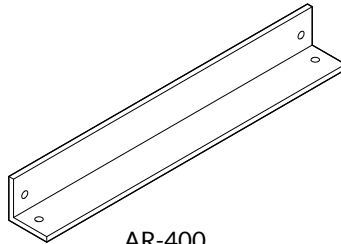

AR-400  
2x

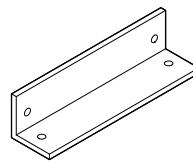


AR-200  
1x

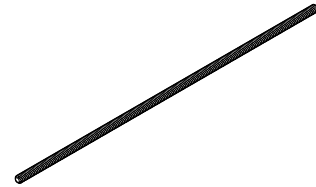


LS-400  
2x




LS-200  
1x

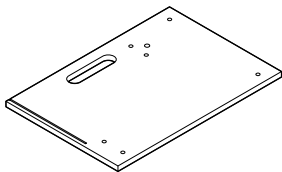


F-L  
1x

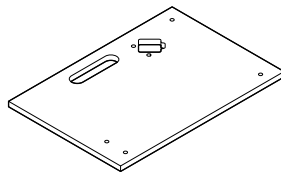


F-R  
1x

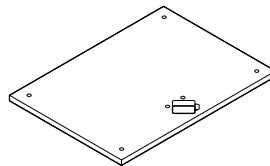


F-B  
1x

 


F-F  
1x

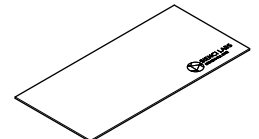

F-AC  
1x

 

G-Y  
1x

 

G-XZ  
1x


## Tools:



 Phillips




8mm  
Wrench




SIENCI LABS  
DESKTOP CNC MILLING

## STEP 1

### Lead Screw Nut Holding Assembly

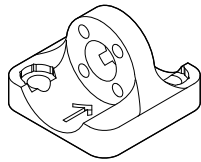

P-NH  
**3x**

 


A-N  
**3x**



M3-8  
**12x**



2.5  
Allen

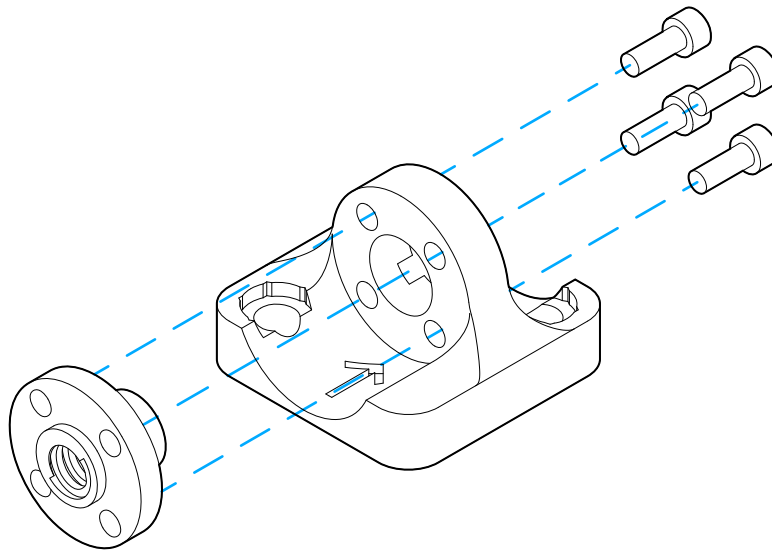

**3x**

 
\*\*If you have purchased the anti-backlash nut kit for your Sienci Mill One, then the lead screw assembly above will be replaced by the anti-backlash nut assembly. Follow the instructions provided on the bag of the kit instead.




**SIENCI LABS**  
DESKTOP CNC MILLING

**STEP 2**

XZ Gantry  
Assembly



G-XZ  
**1x**

 


M5-25  
**2x**



M5-N  
**2x**




4  
Allen

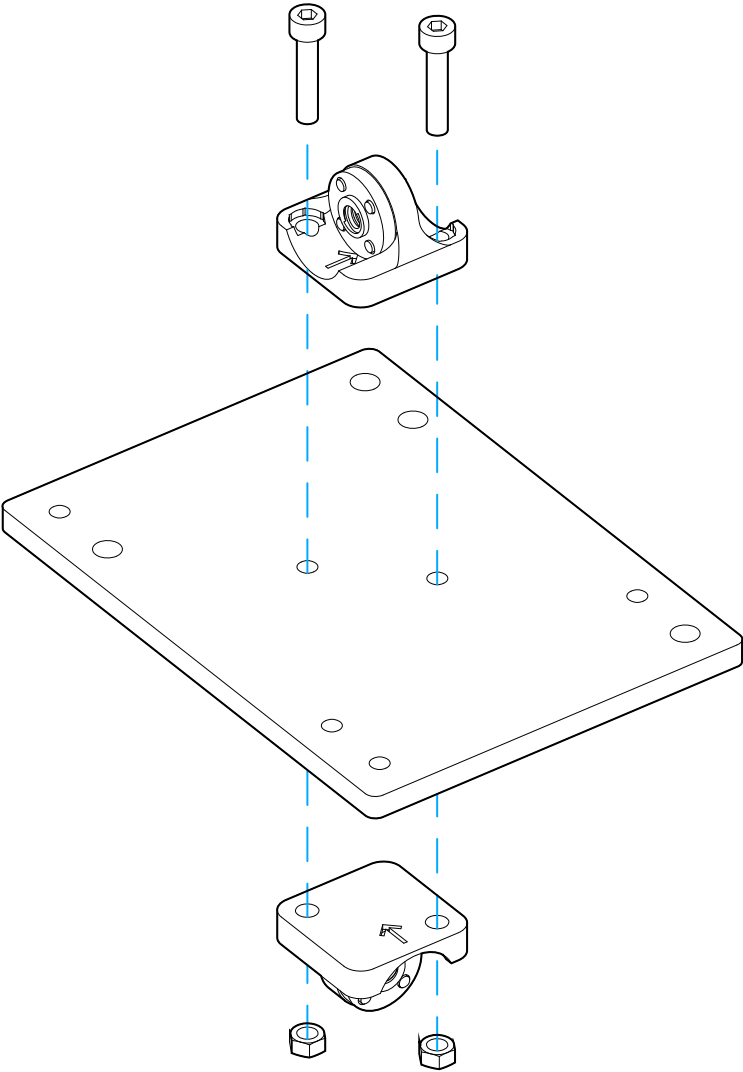


## STEP 3
 
### Y Gantry Assembly



G-Y  
**1x**

 



M5-25  
**2x**



M5-N  
**2x**



 4  
Allen

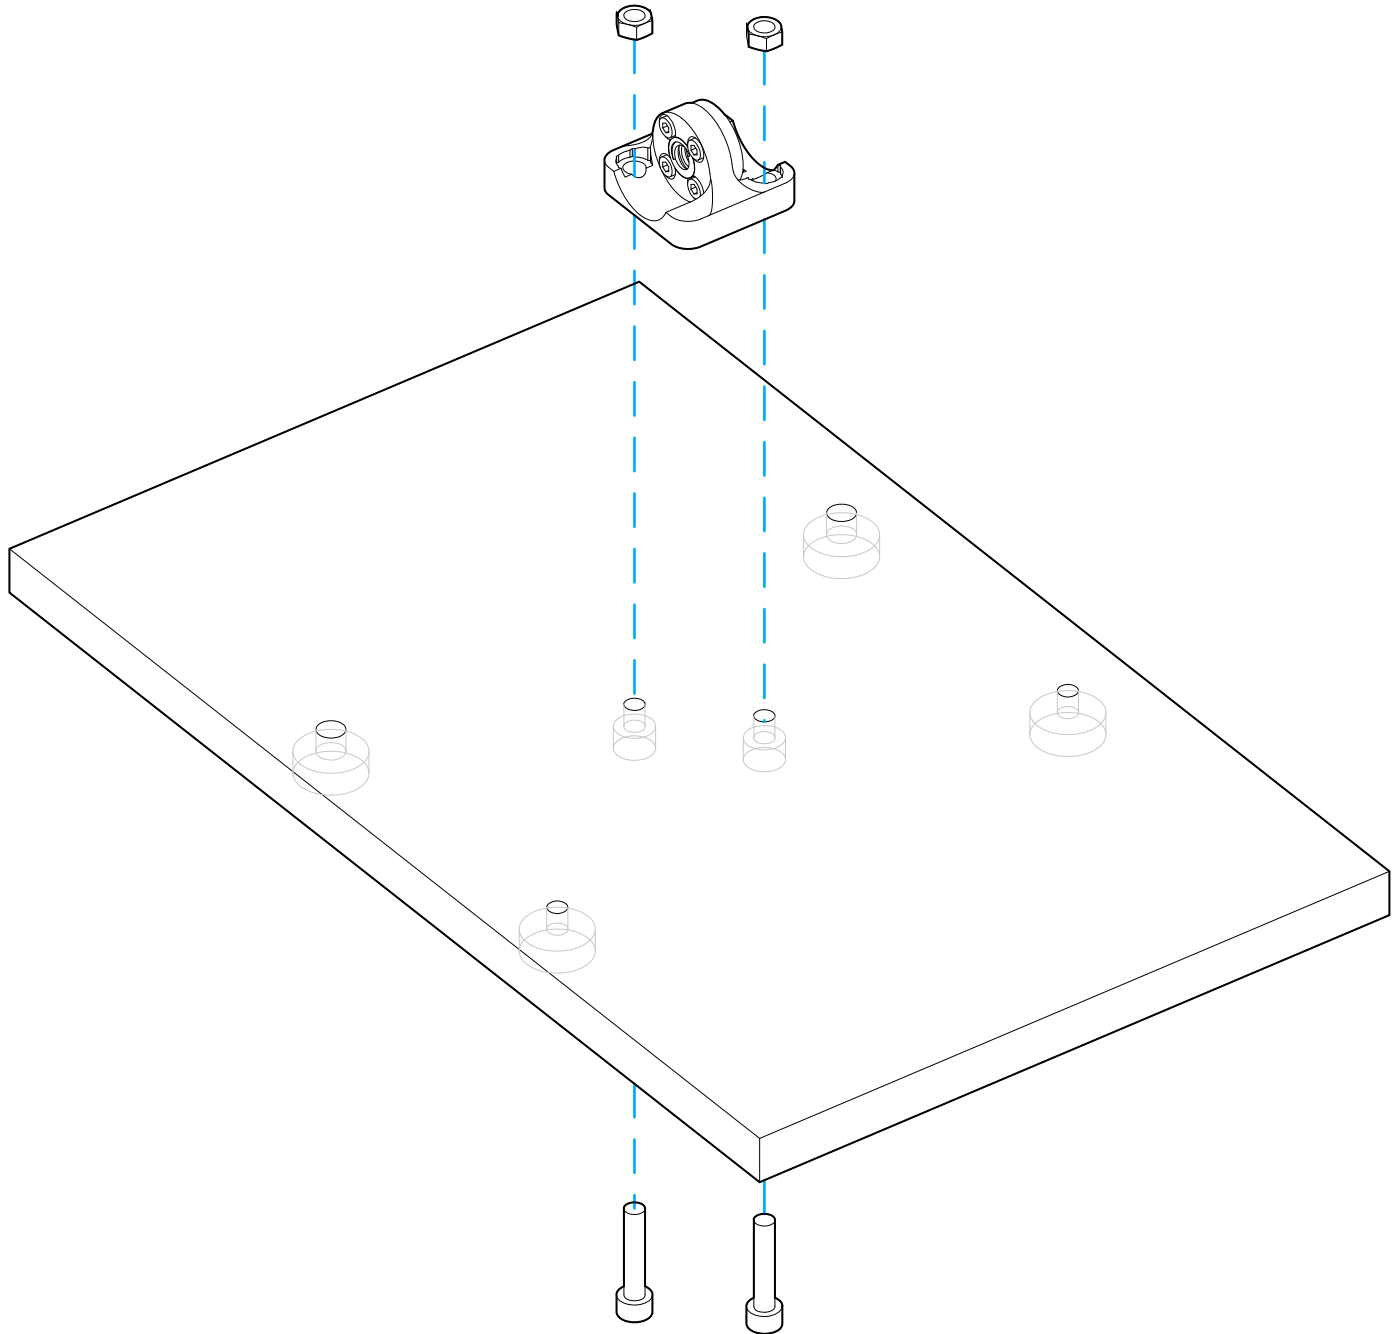


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 4
 
### XZ Gantry Assembly



VB  
4x



M5-25  
4x



M5-W  
4x



M5-N  
2x




M5-NE  
2x




4  
Allen



8mm  
Wrench

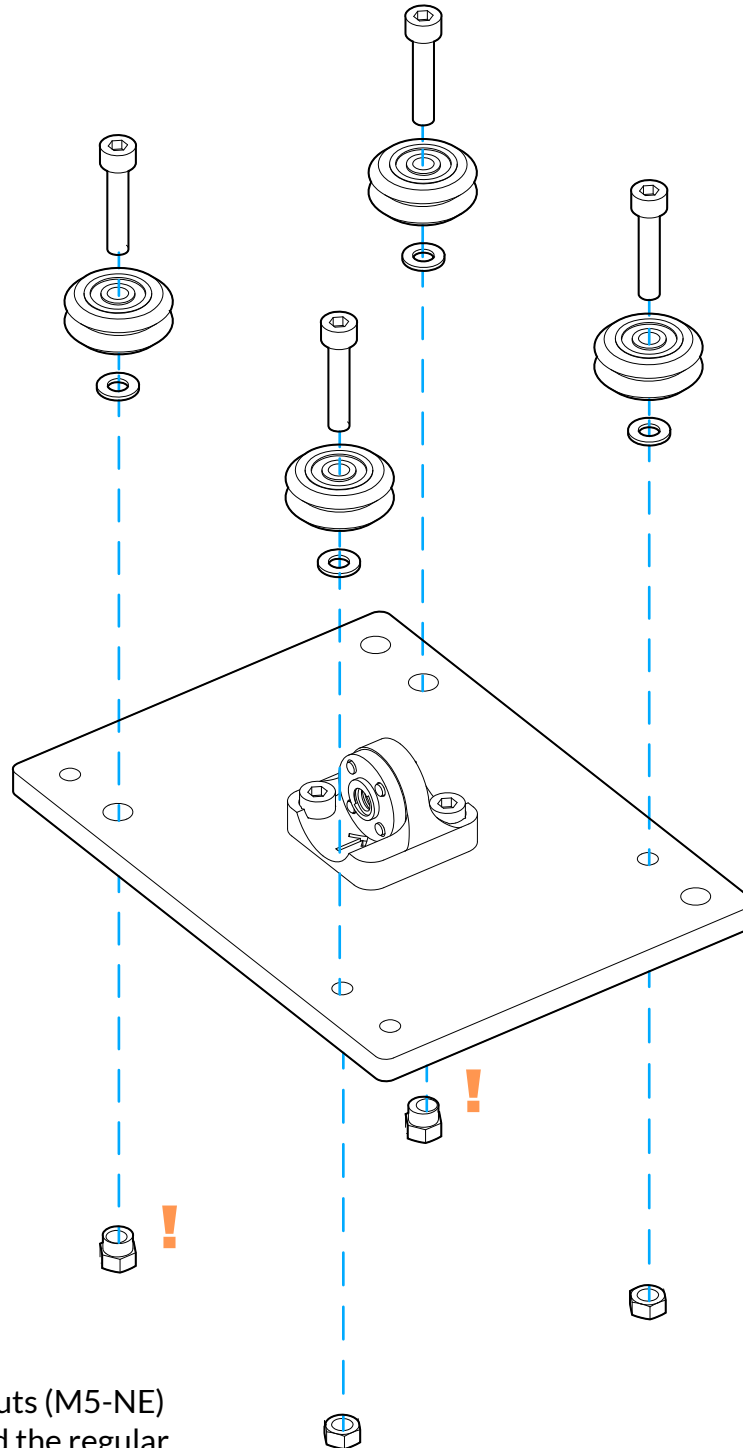

 ! Match the eccentric nuts (M5-NE) to the larger holes, and the regular nuts (M5-N) to the smaller holes




SIENCI LABS  
DESKTOP CNC MILLING

## STEP 5
 
### XZ Gantry Assembly



VB  
4x



M5-25  
4x



M5-W  
4x



M5-N  
2x




M5-NE  
2x




4  
Allen



8mm  
Wrench

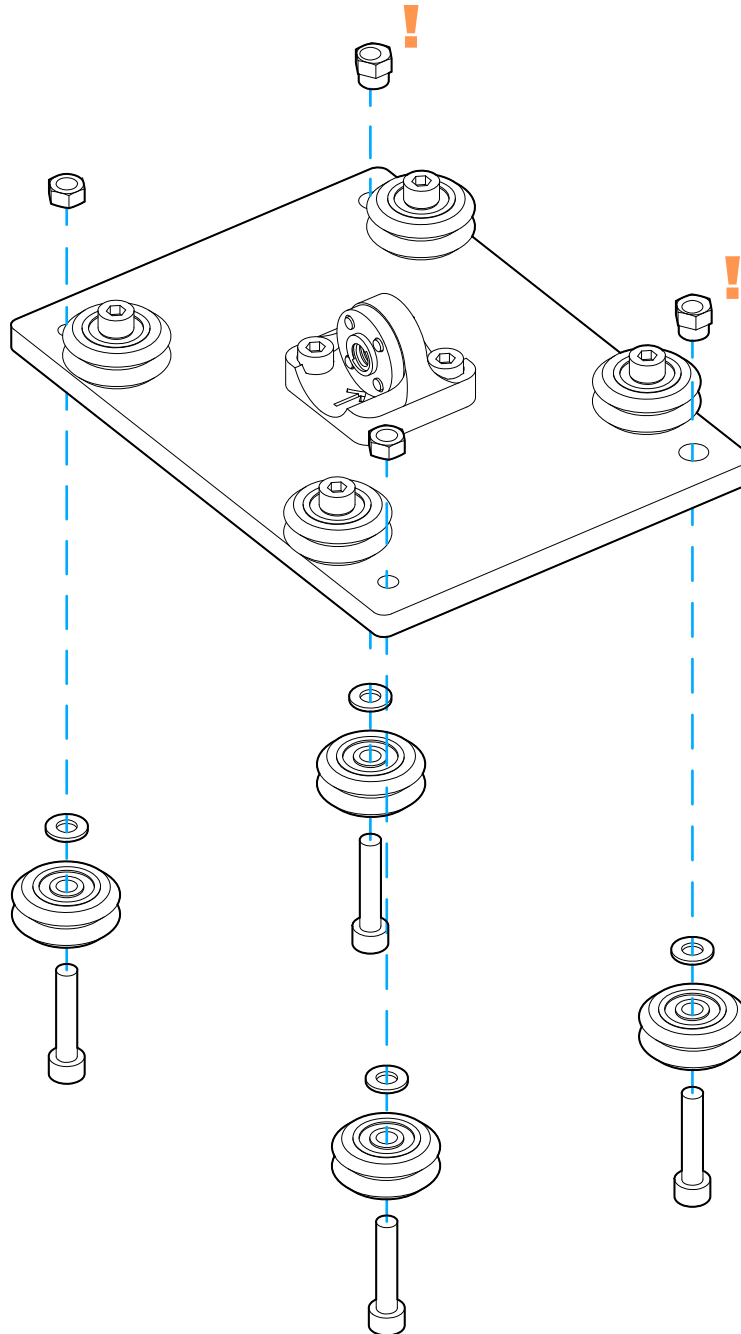

 ! Match the eccentric nuts (M5-NE) to the larger holes, and the regular nuts (M5-N) to the smaller holes



SIENCI LABS  
DESKTOP CNC MILLING




## STEP 6
 
### Y Gantry Assembly



VB  
4x



M5-25  
4x



M5-W  
4x



M5-N  
2x




M5-NE  
2x




4  
Allen



8mm  
Wrench

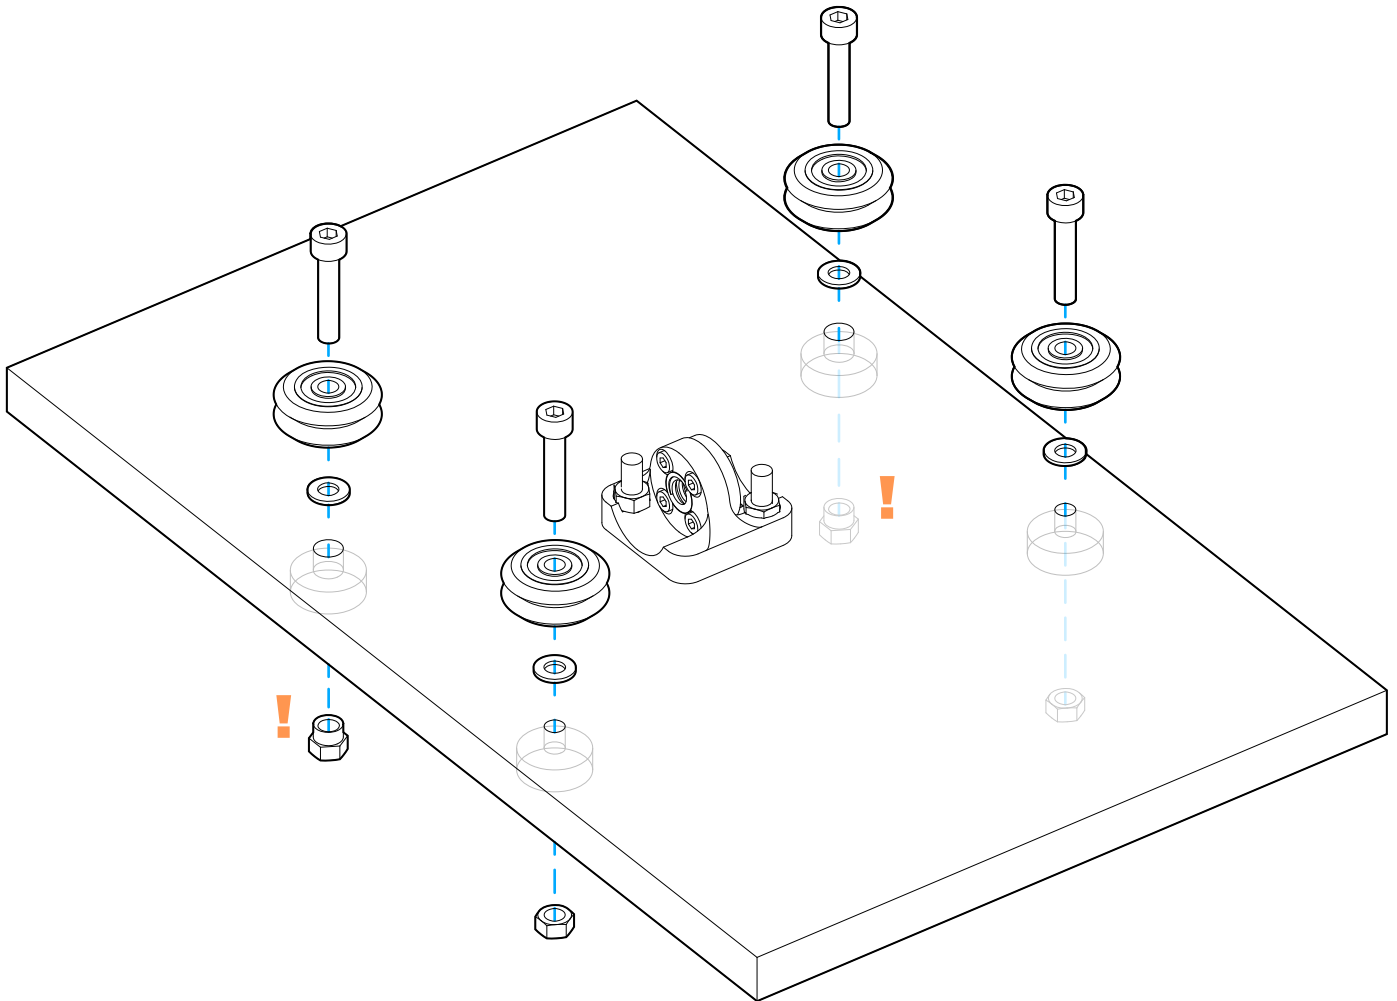

 
! Match the eccentric nuts (M5-NE) to the larger holes, and the regular nuts (M5-N) to the smaller holes




**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 7

Mounting the  
Motors to the  
Rails

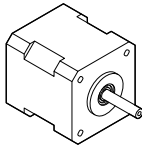

SM  
3x

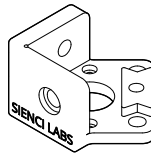


P-AM  
3x



M3-8  
12x



2.5  
Allen

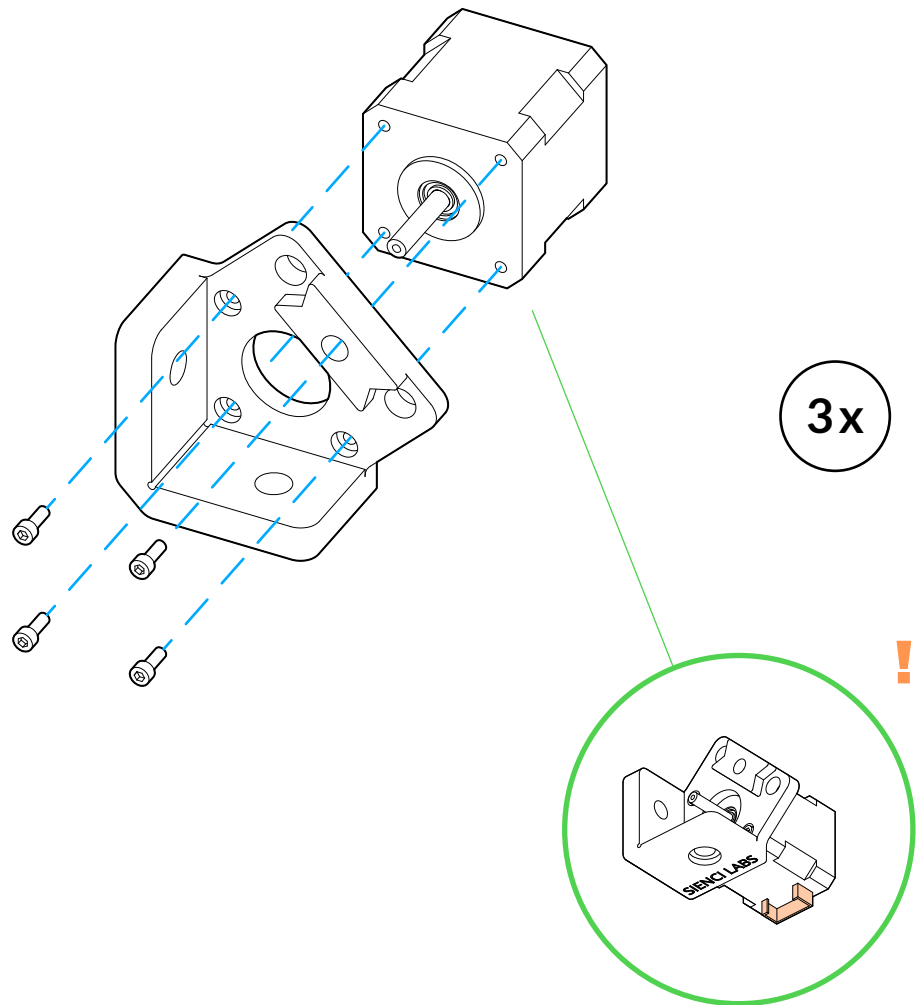






! Make sure that the motor connector is facing downwards



**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 8

 Mounting the  
Motors to the  
Rails

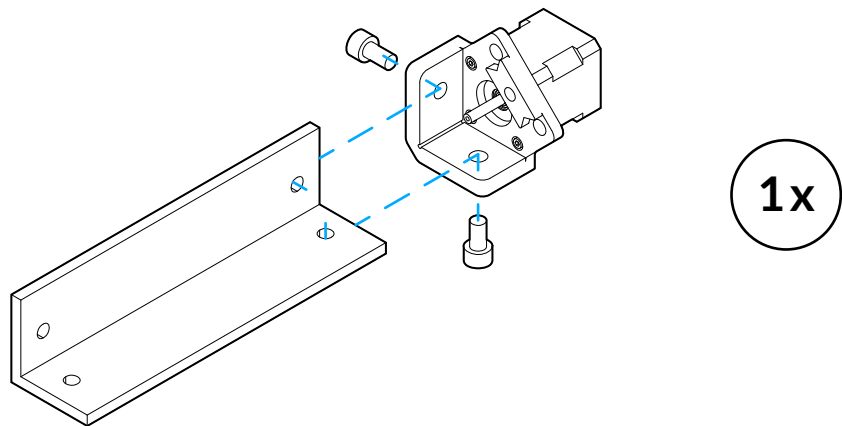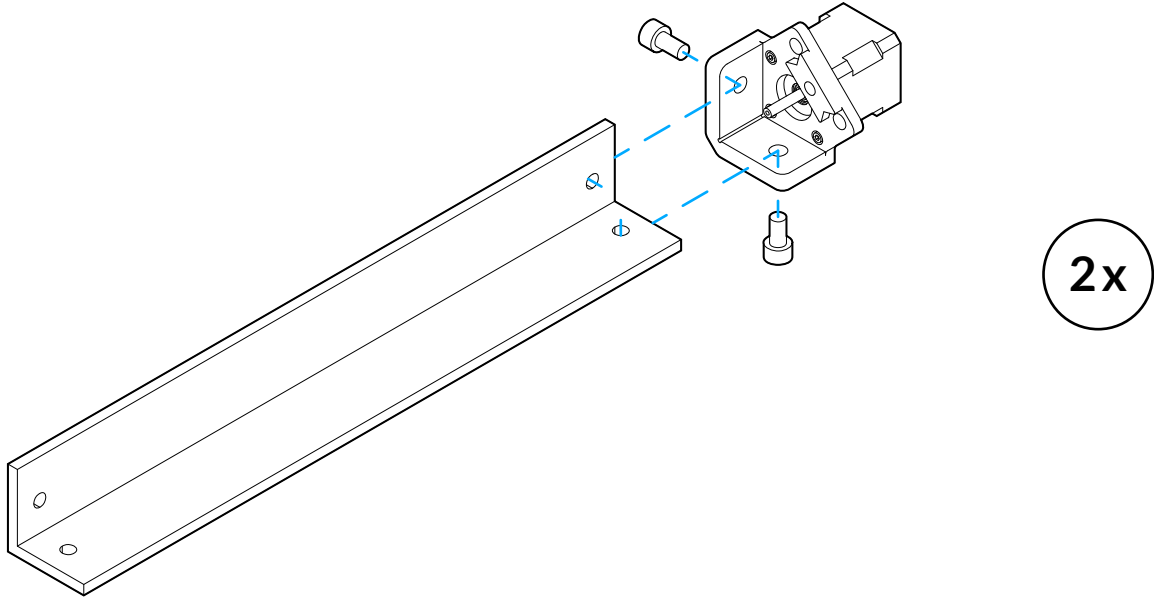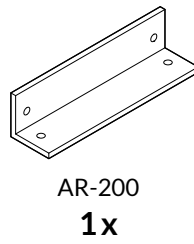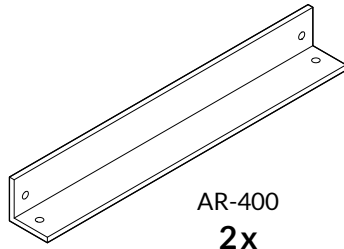


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 9

 Attaching  
Z-Lead Screw  
to XZ Gantry




LS-200  
**1x**



SC  
**1x**



2  
Allen

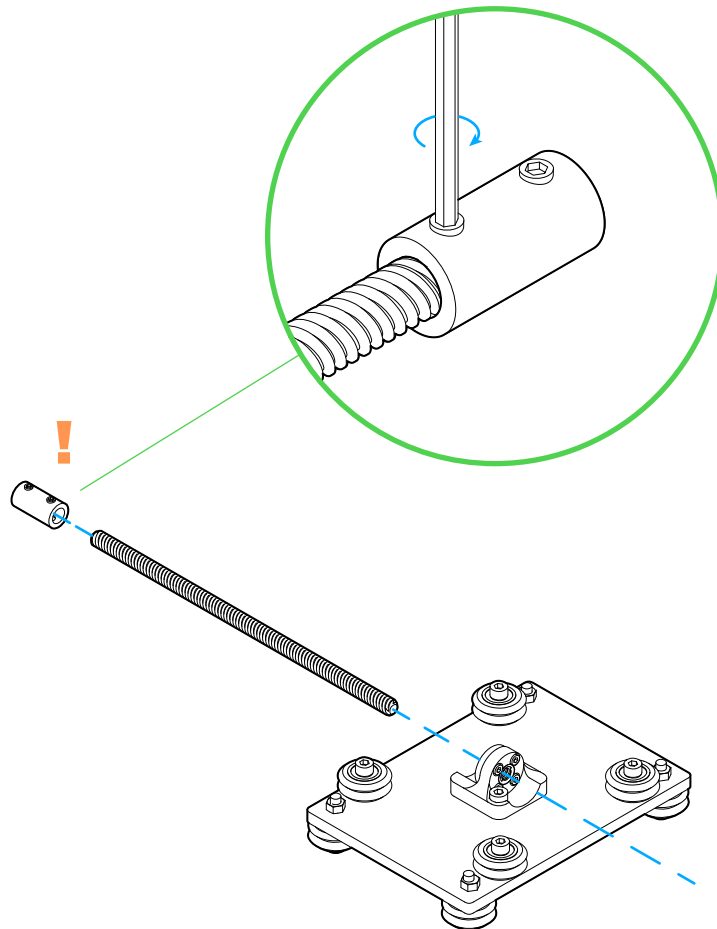



! Make sure to push coupler all the way onto lead screw before tightening



**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 10

Attaching the  
Z-Rail to the XZ  
Gantry

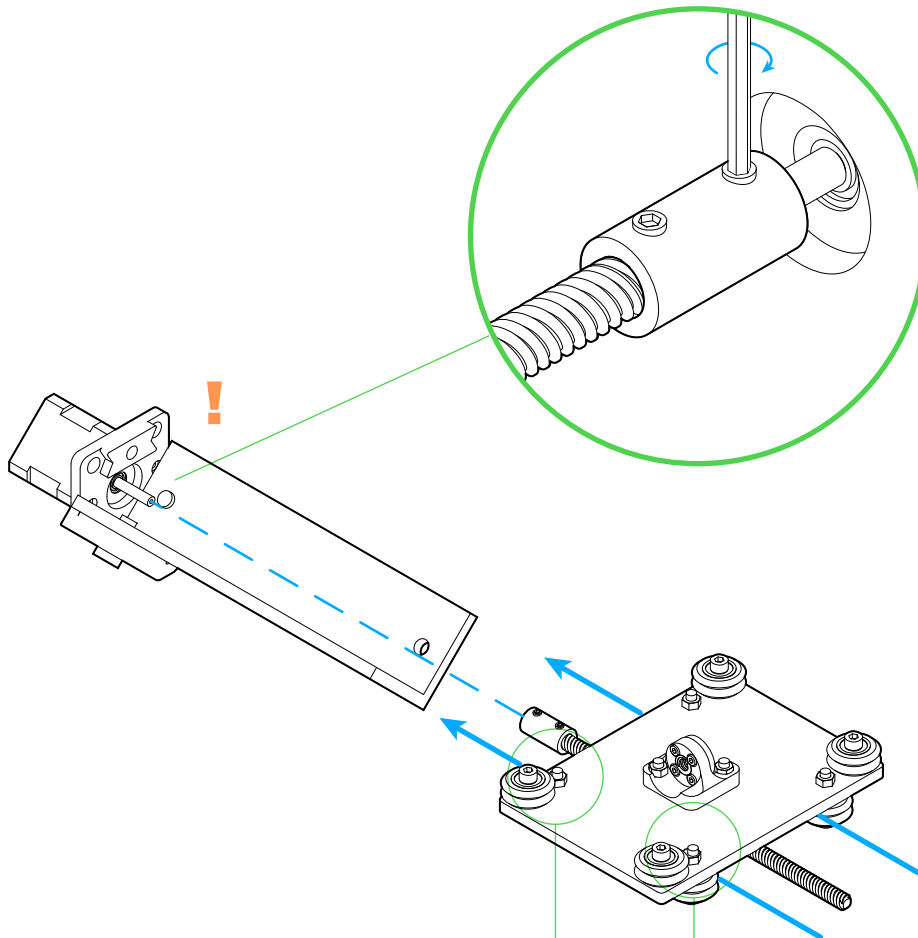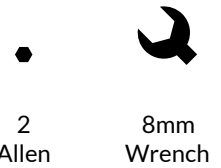


Rotate the eccentric nuts (M5-NE)  
until gantry slides onto the rail easily


! Make sure to push coupler all the way onto  
motor shaft before tightening

## STEP 11

Attaching the  
X-Lead screw to  
the XZ Gantry  
and Calibration

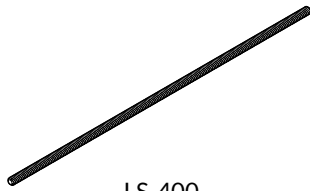

LS-400  
2x

 


SC  
1x



2  
Allen



8mm  
Wrench

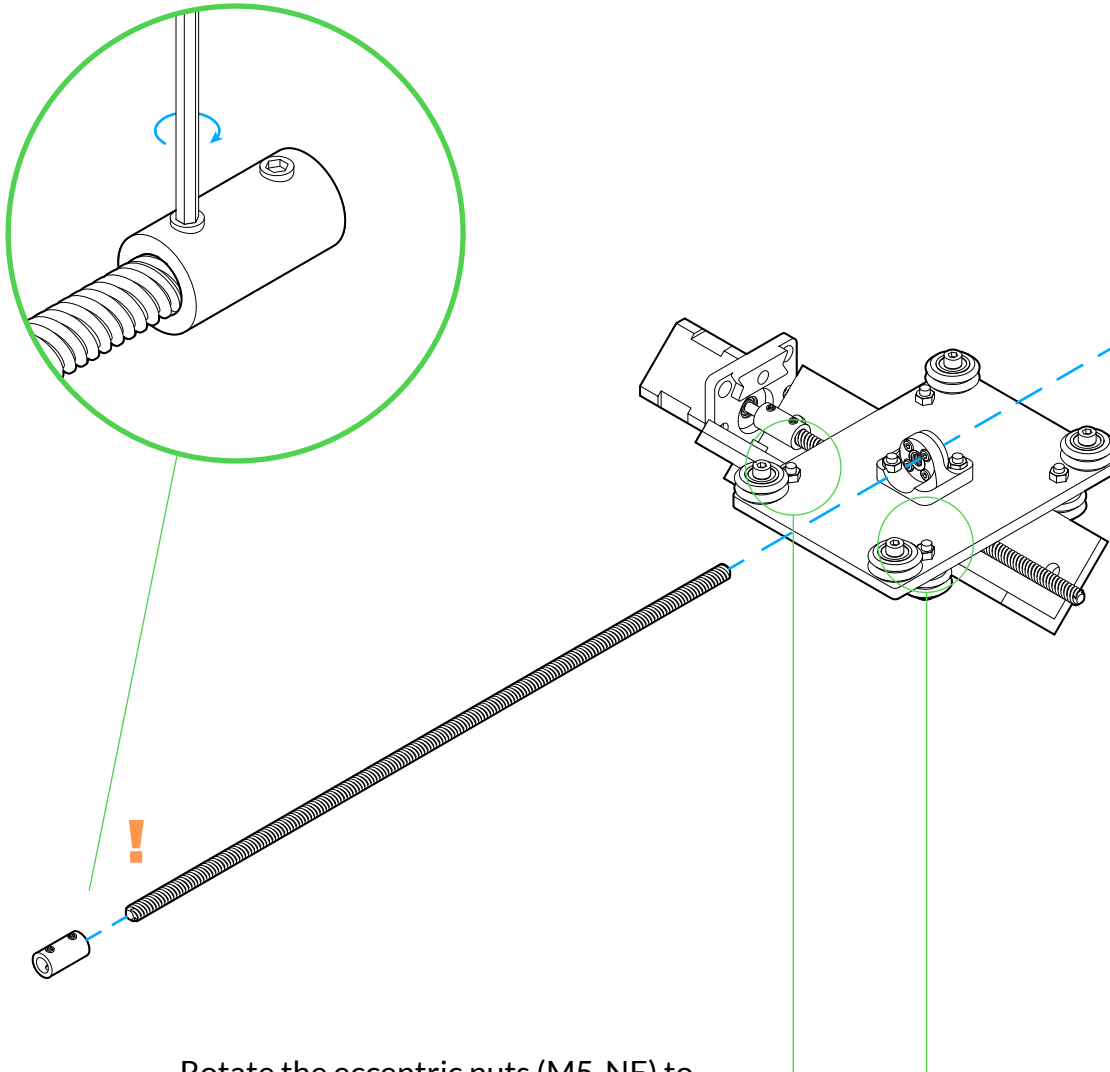

Rotate the eccentric nuts (M5-NE) to  
tighten the grip of the wheels on the rail.  
Tighten until you can no longer rotate  
the V Groove bearings (VB) with your  
fingers.



! Make sure to push coupler all the way onto lead  
screw before tightening



**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 12

Attaching the  
X-Rail to the XZ  
Gantry

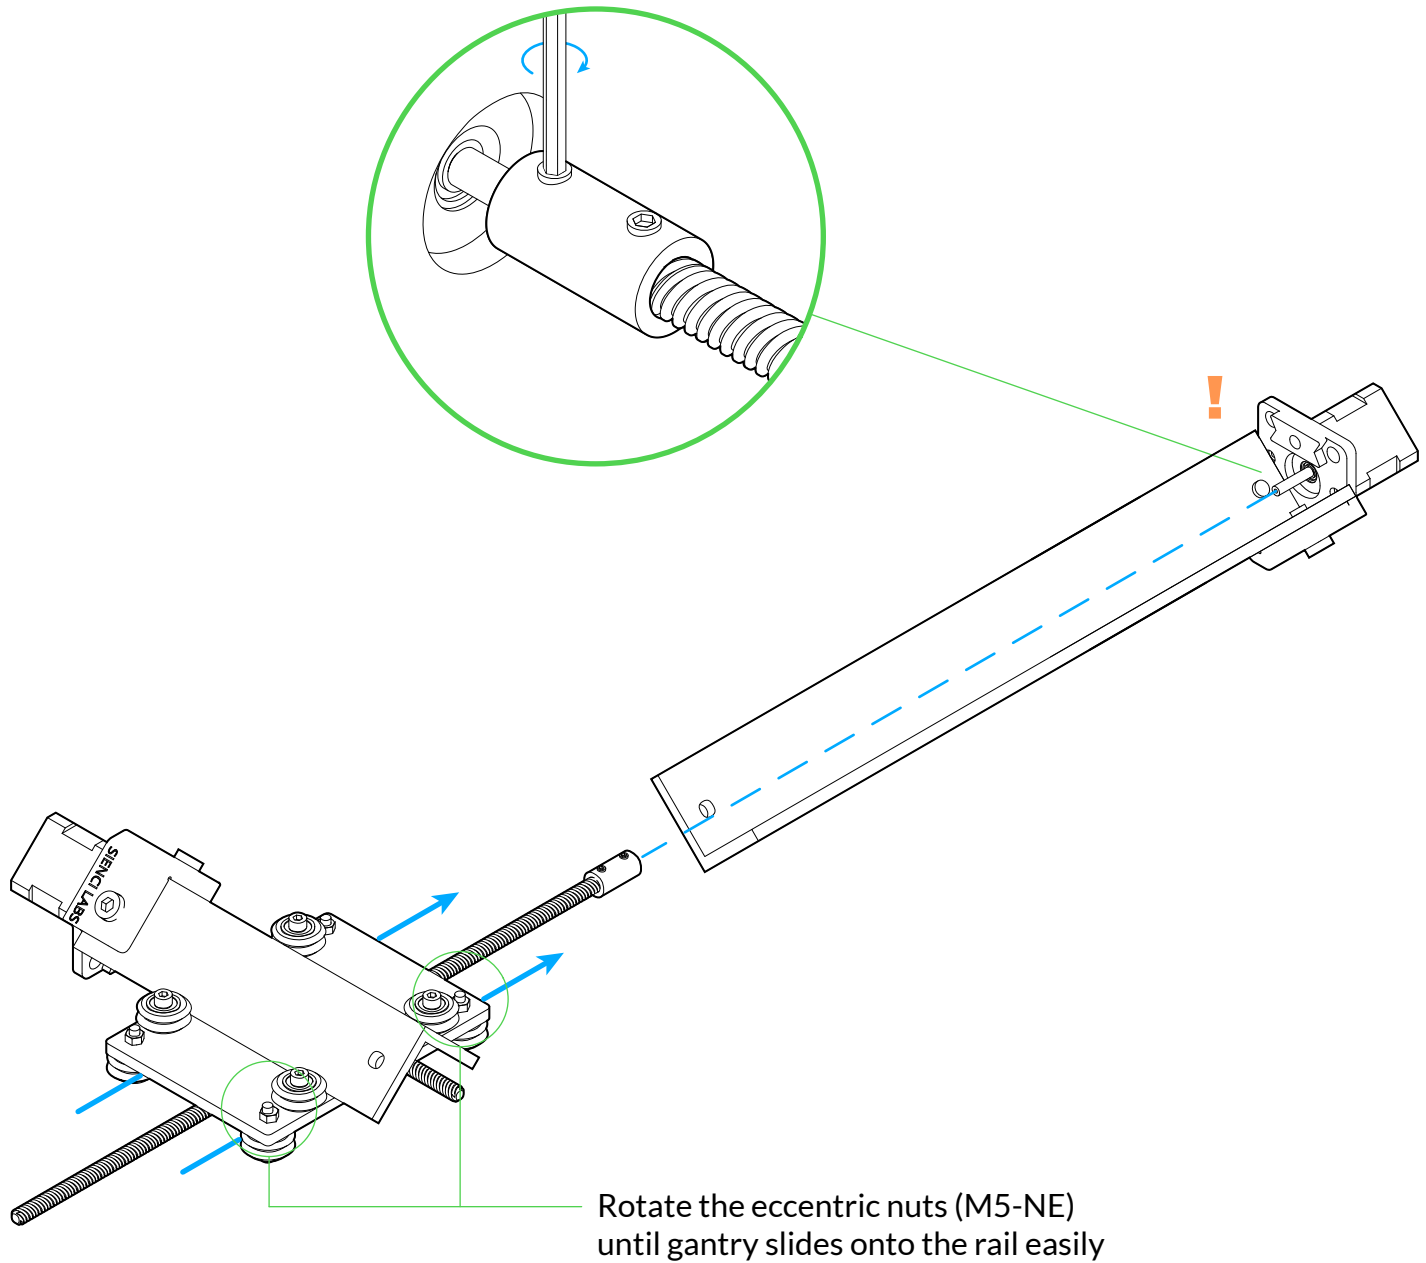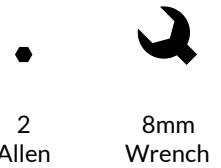


! Make sure to push coupler all the way onto  
motor shaft before tightening

## STEP 13

 Attaching the  
Z-Rail to the XZ  
Gantry and  
Calibration



P-AM  
**1x**




M8-15  
**2x**




6  
Allen



8mm  
Wrench

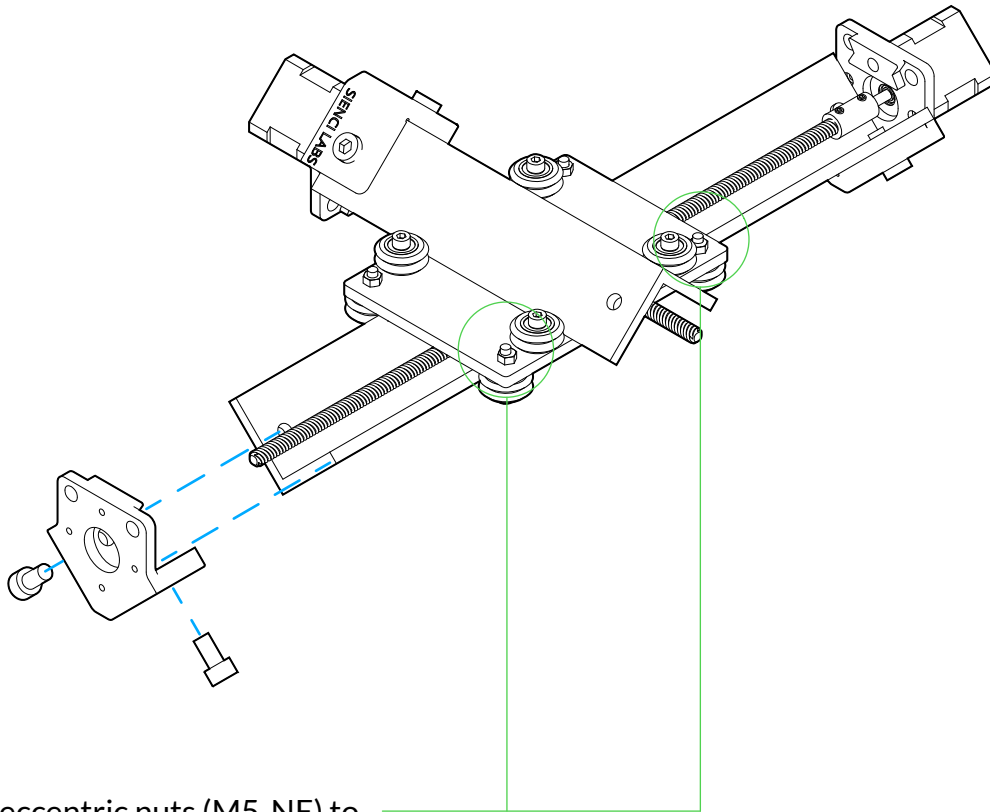

 Rotate the eccentric nuts (M5-NE) to  
tighten the grip of the wheels on the rail.  
Tighten until you can no longer rotate  
the V Groove bearings (VB) with your  
fingers.




**SIENCI LABS**  
DESKTOP CNC MILLING




## STEP 15

Attaching Lead  
Screw to Y  
Gantry

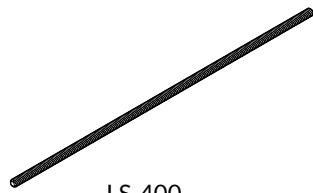


LS-400  
1x

 

SC  
1x



2  
Allen

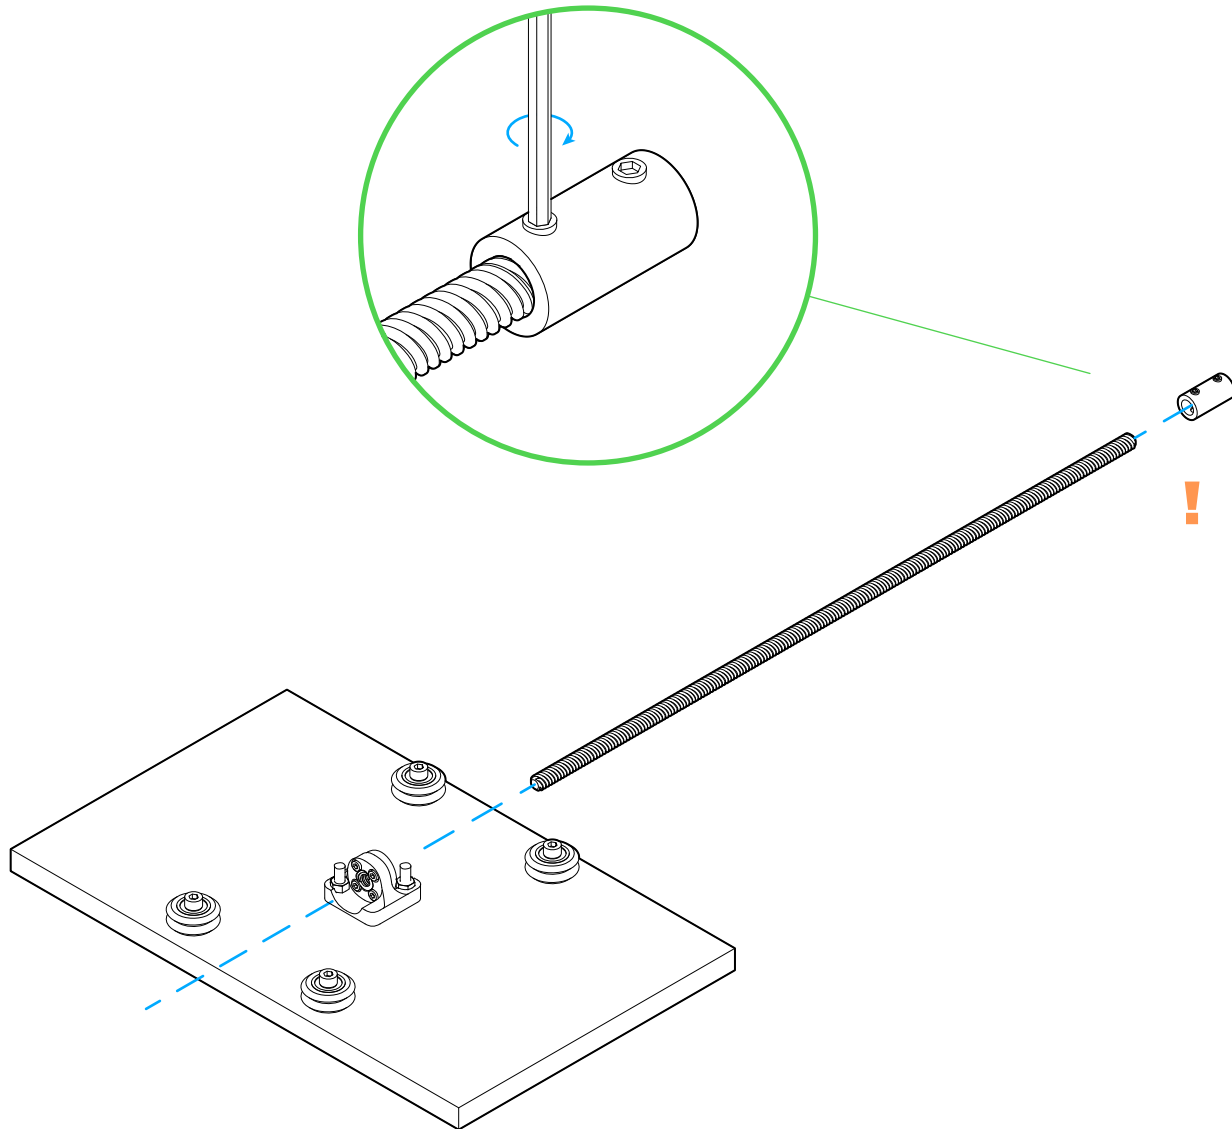

! Make sure to push coupler all the way onto lead screw before tightening




SIENCI LABS  
DESKTOP CNC MILLING

## STEP 15

Attaching the  
Y-Rail to the Y  
Gantry


2  
Allen  
8mm  
Wrench

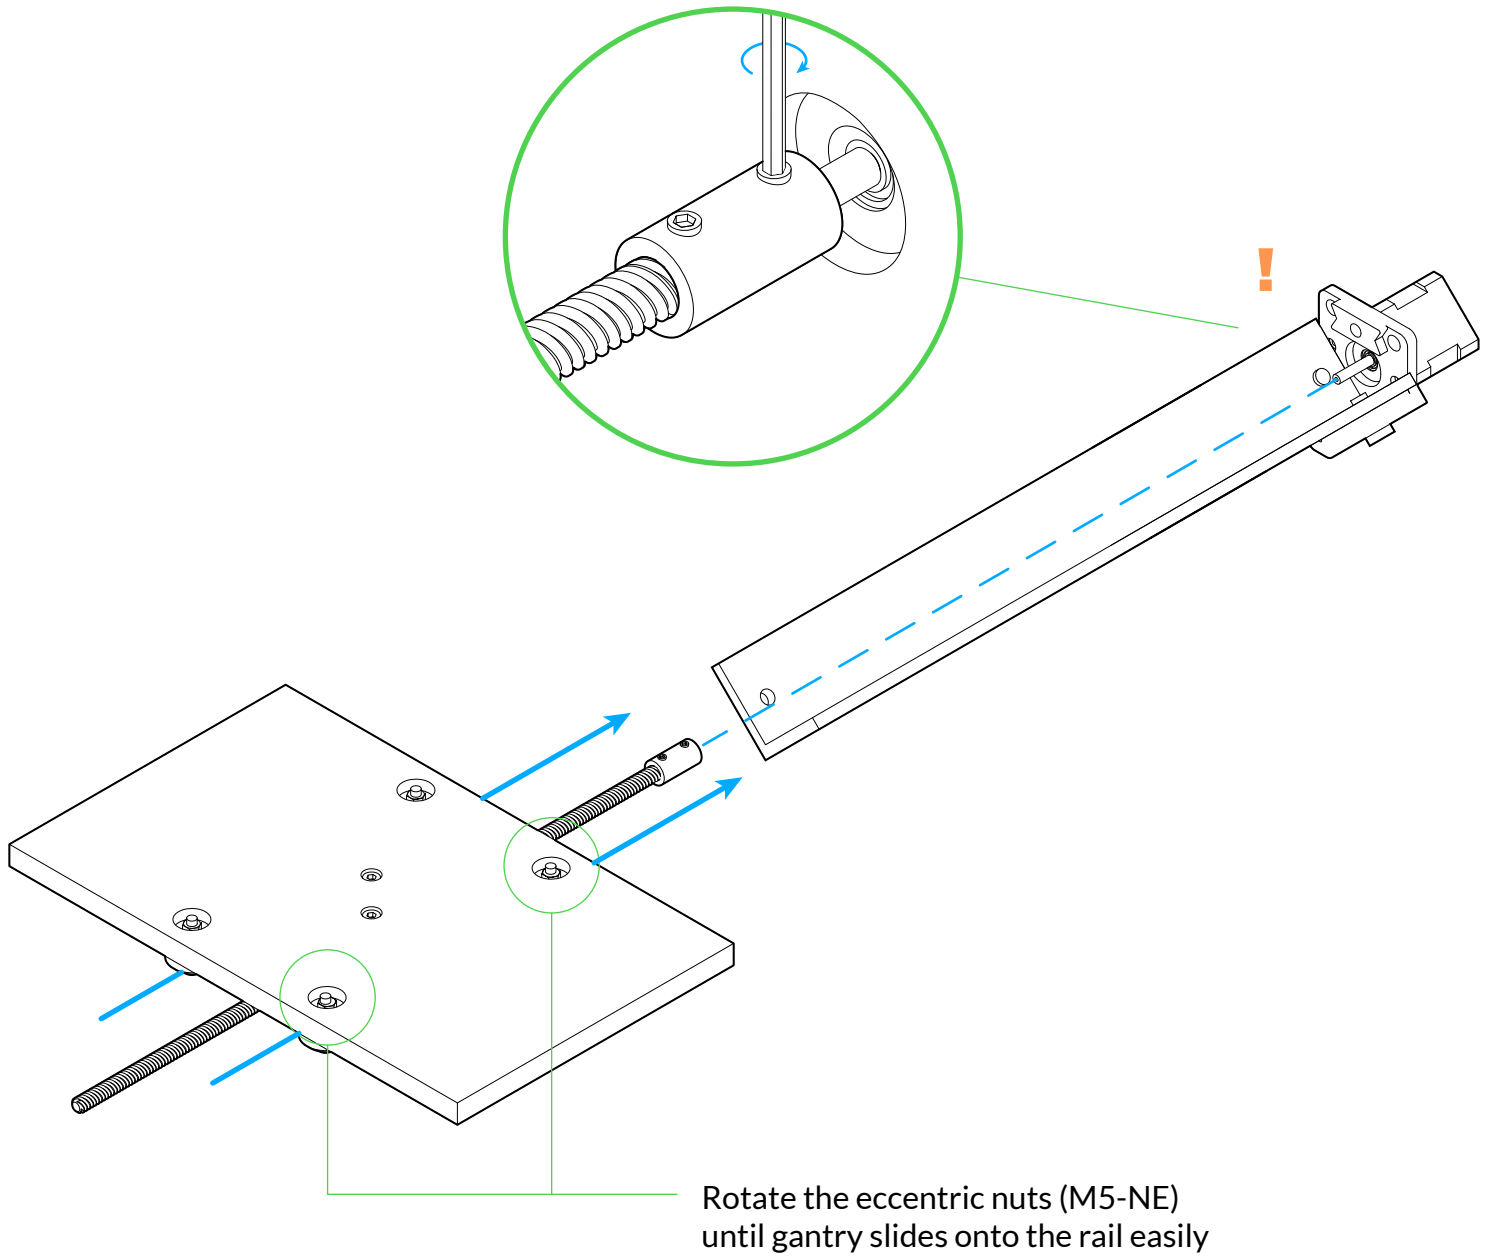


! Make sure to push coupler all the way onto  
motor shaft before tightening

## STEP 16

Attaching the  
Y-Rail to the Y  
Gantry

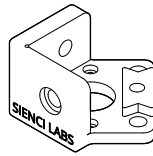

P-AM  
**1x**

 

M8-15  
**2x**

 



6  
Allen



8mm  
Wrench


Rotate the eccentric nuts (M5-NE) to  
tighten the grip of the wheels on the rail.  
Tighten until you can no longer rotate  
the V Groove bearings (VB) with your  
fingers.

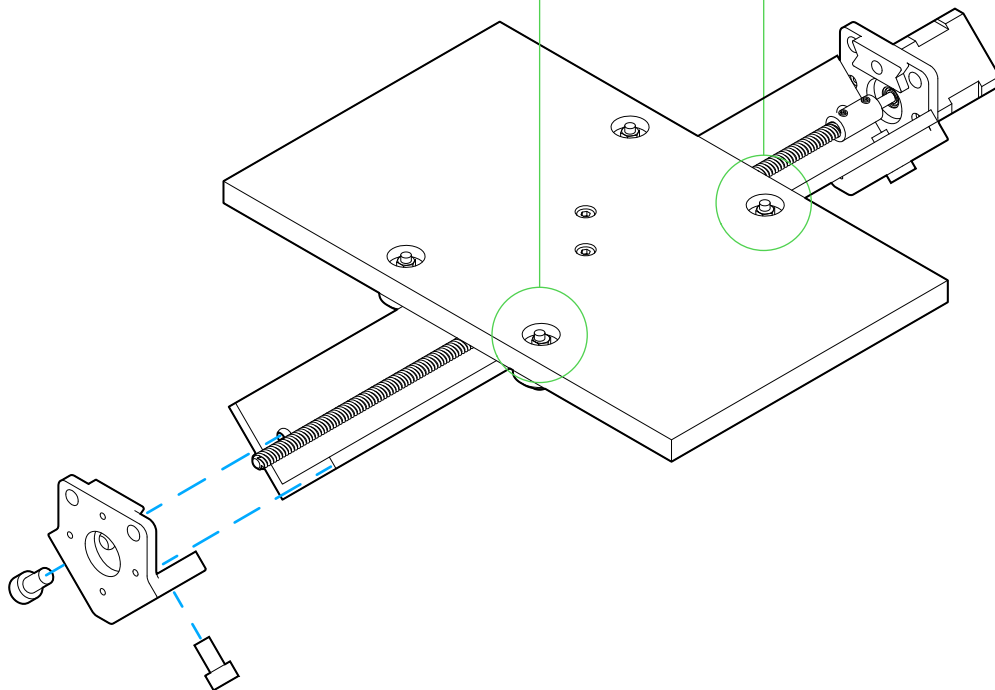


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 17


Attaching Y  
Gantry to  
Frame

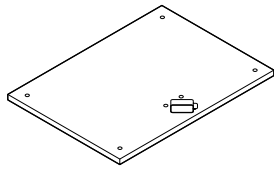

F-B  
**1x**

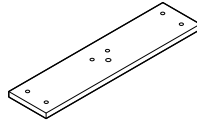

F-F  
**1x**

 


M8-25  
**4x**



M8-N  
**4x**




6  
Allen

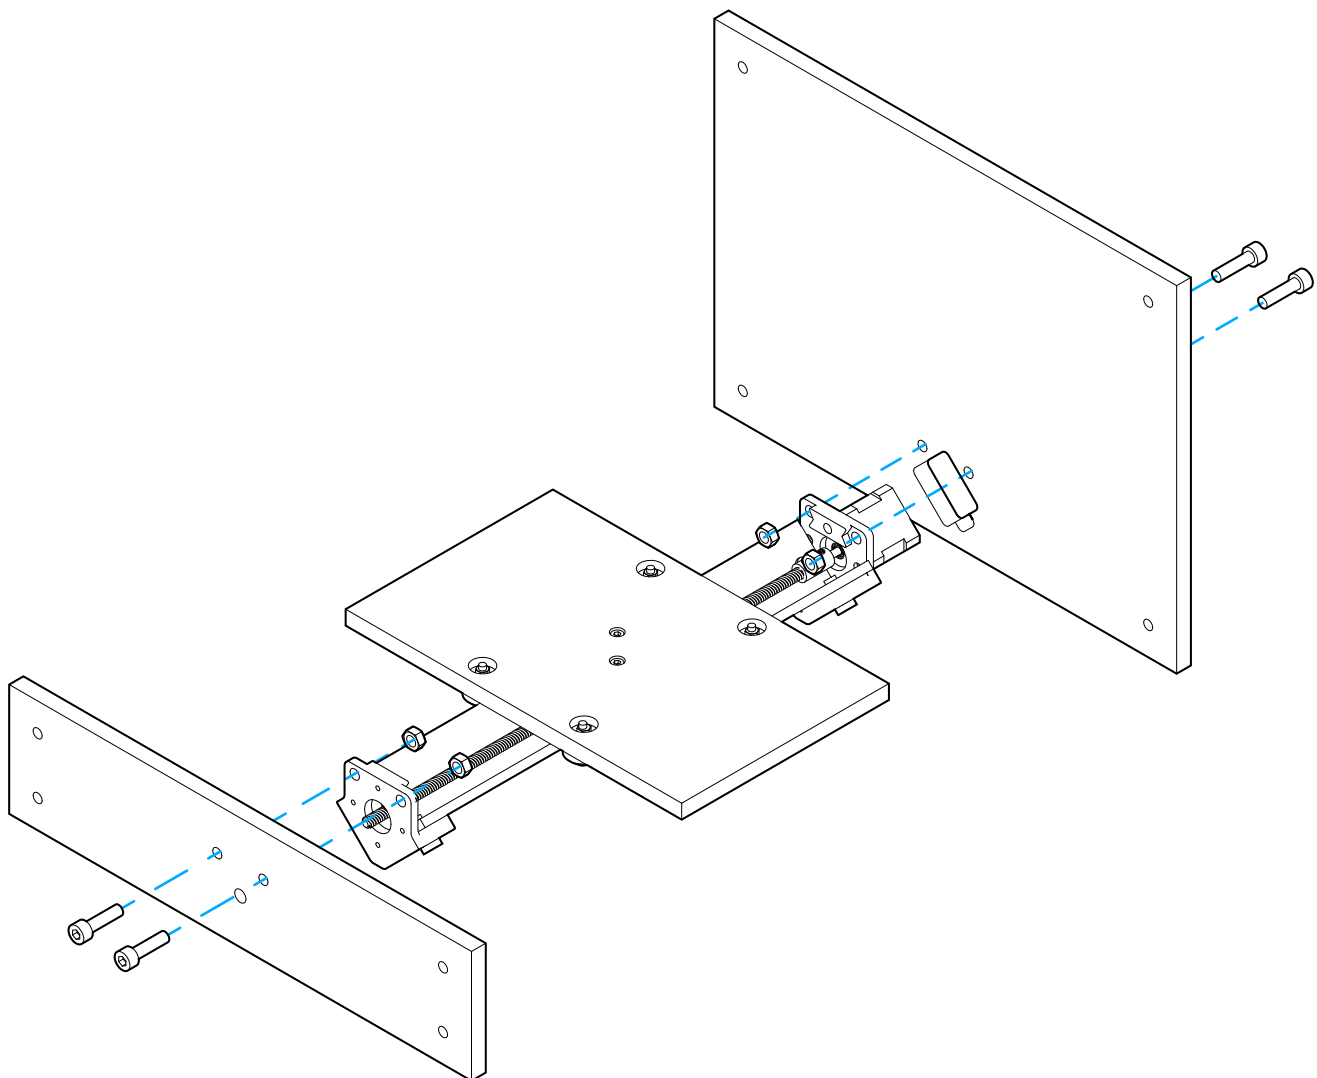


**SIENCI LABS**  
DESKTOP CNC MILLING

**STEP 18**


Attaching XZ  
Gantry to  
Frame

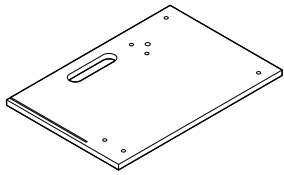

F-L  
**1x**

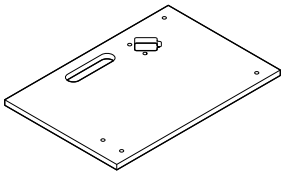

F-R  
**1x**

 


M8-25  
**4x**



M8-N  
**4x**





**6**  
Allen

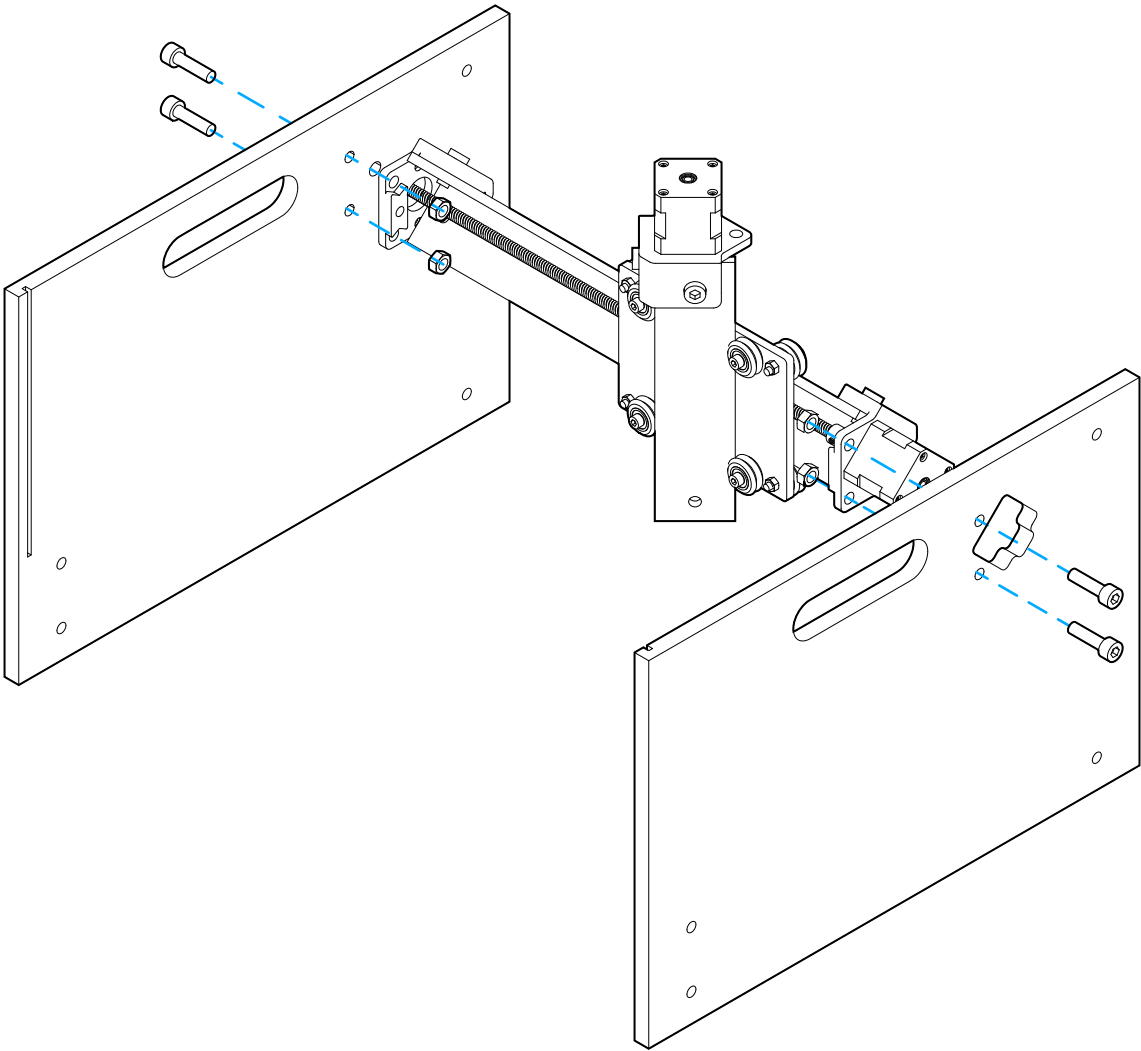

## STEP 19

 
Attaching the  
Assemblies

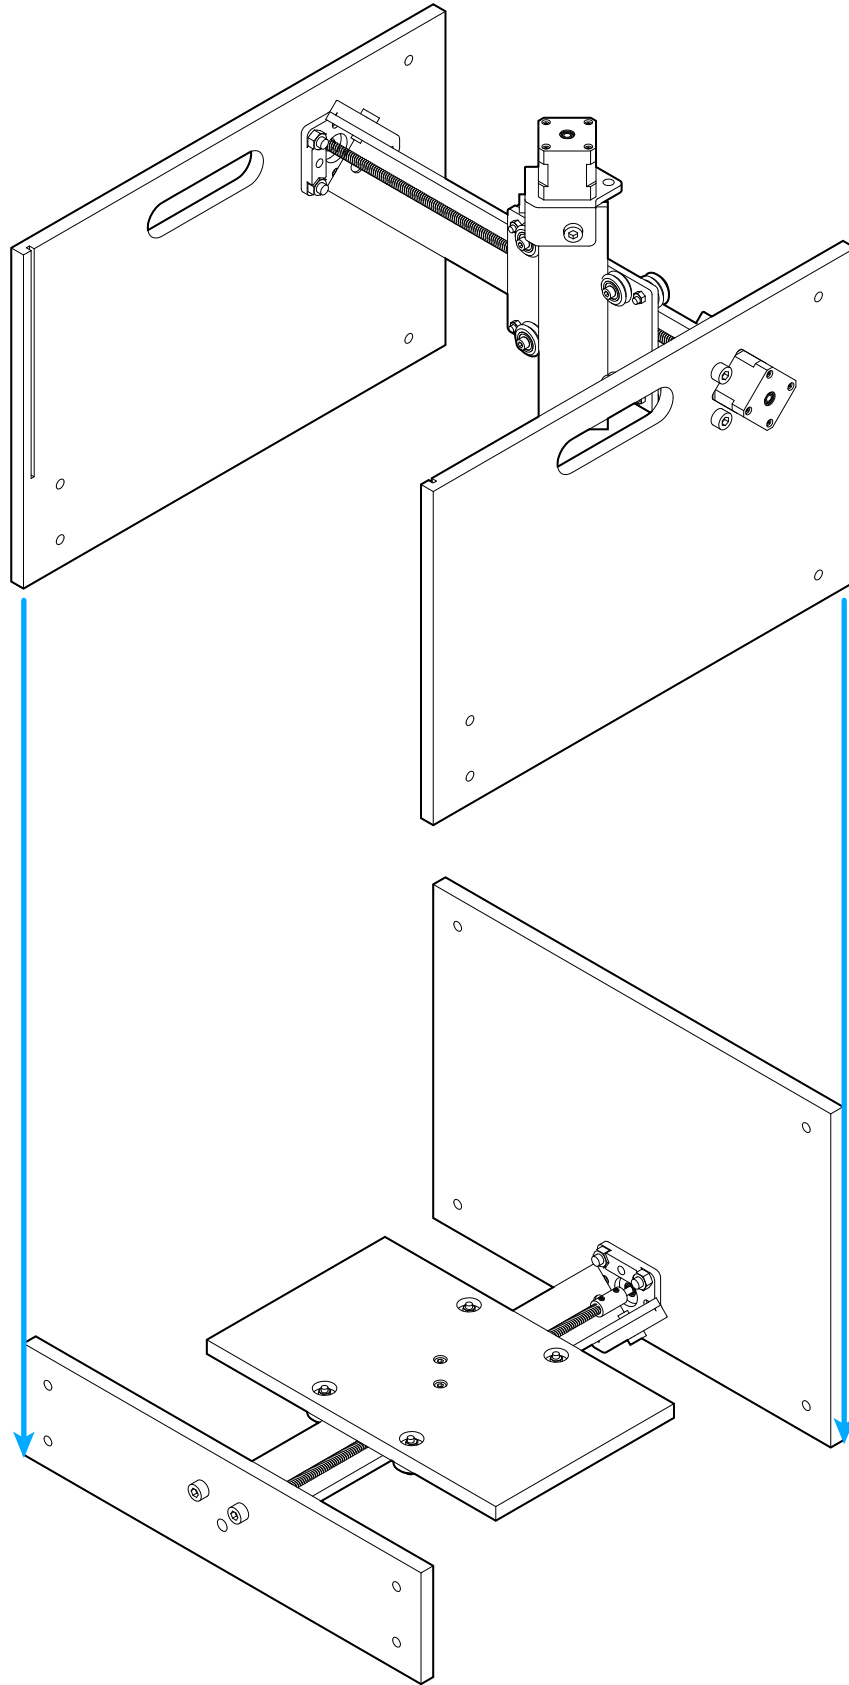


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 20

 Attaching  
Frame Brackets




M-FB  
**8x**

 

M8-15  
**16x**



**6**  
Allen

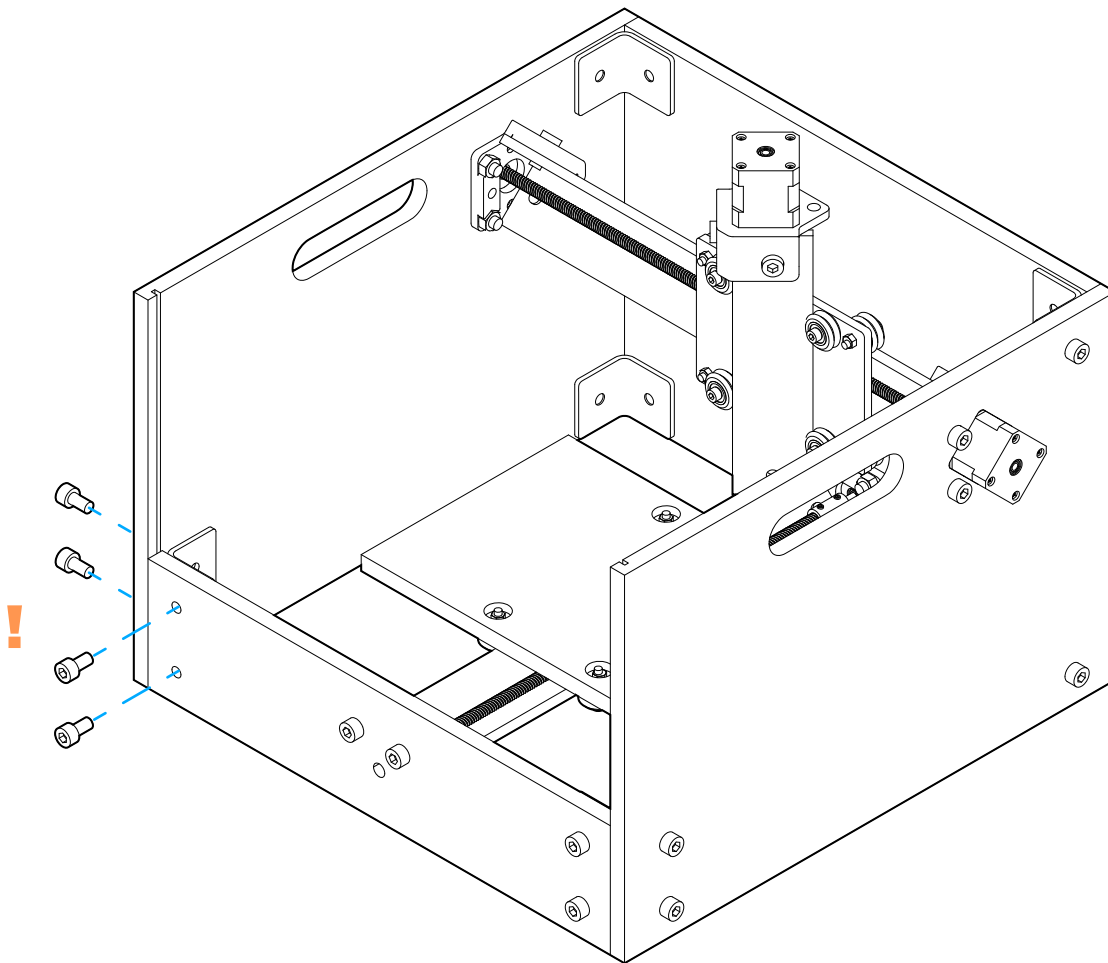


**!** Twist on bolts on all corners loosely,  
then tighten on a flat surface




**SIENCI LABS**  
DESKTOP CNC MILLING

**STEP 21**

Attaching  
Router Mount

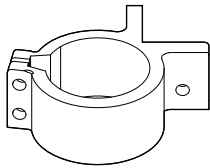


P-RM  
**1x**

 

M8-15  
**2x**



**6**  
Allen

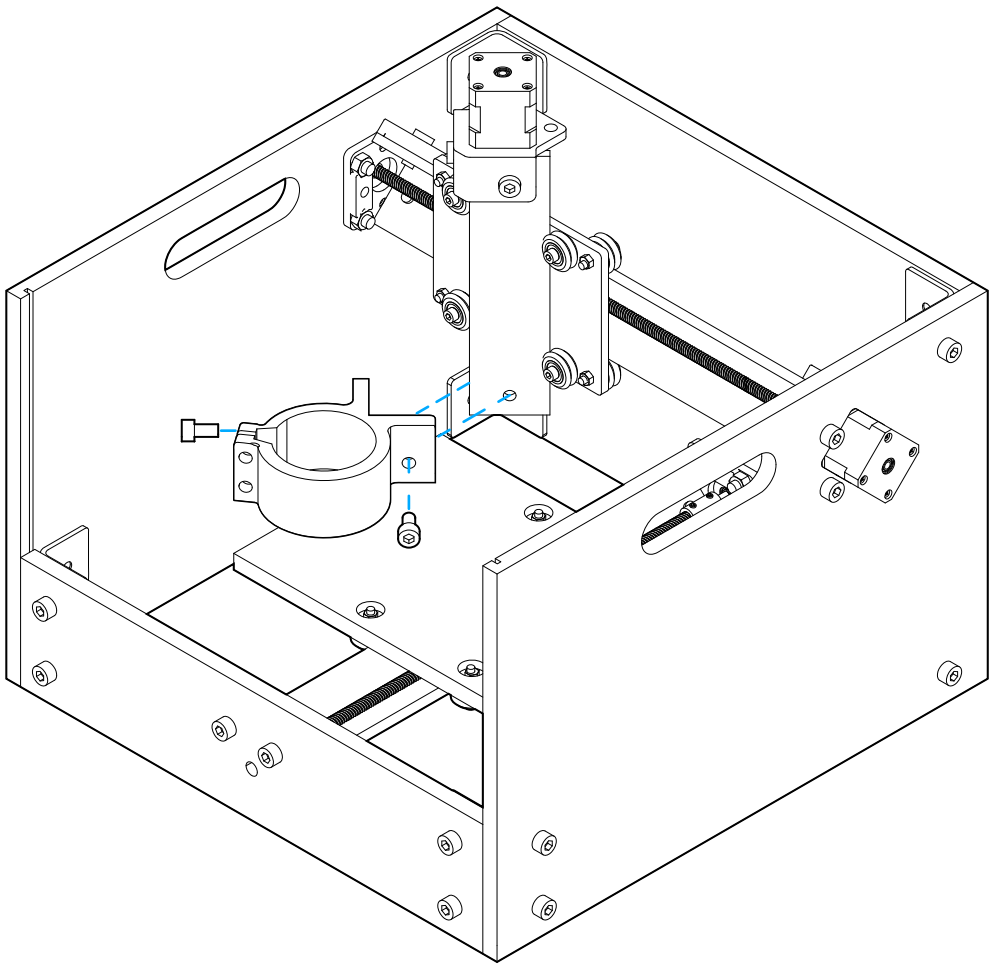




## STEP 22


### Attaching Router



 P-RB  
1x



RO  
1x

 


M8-25  
2x



M8-N  
2x



6  
Allen

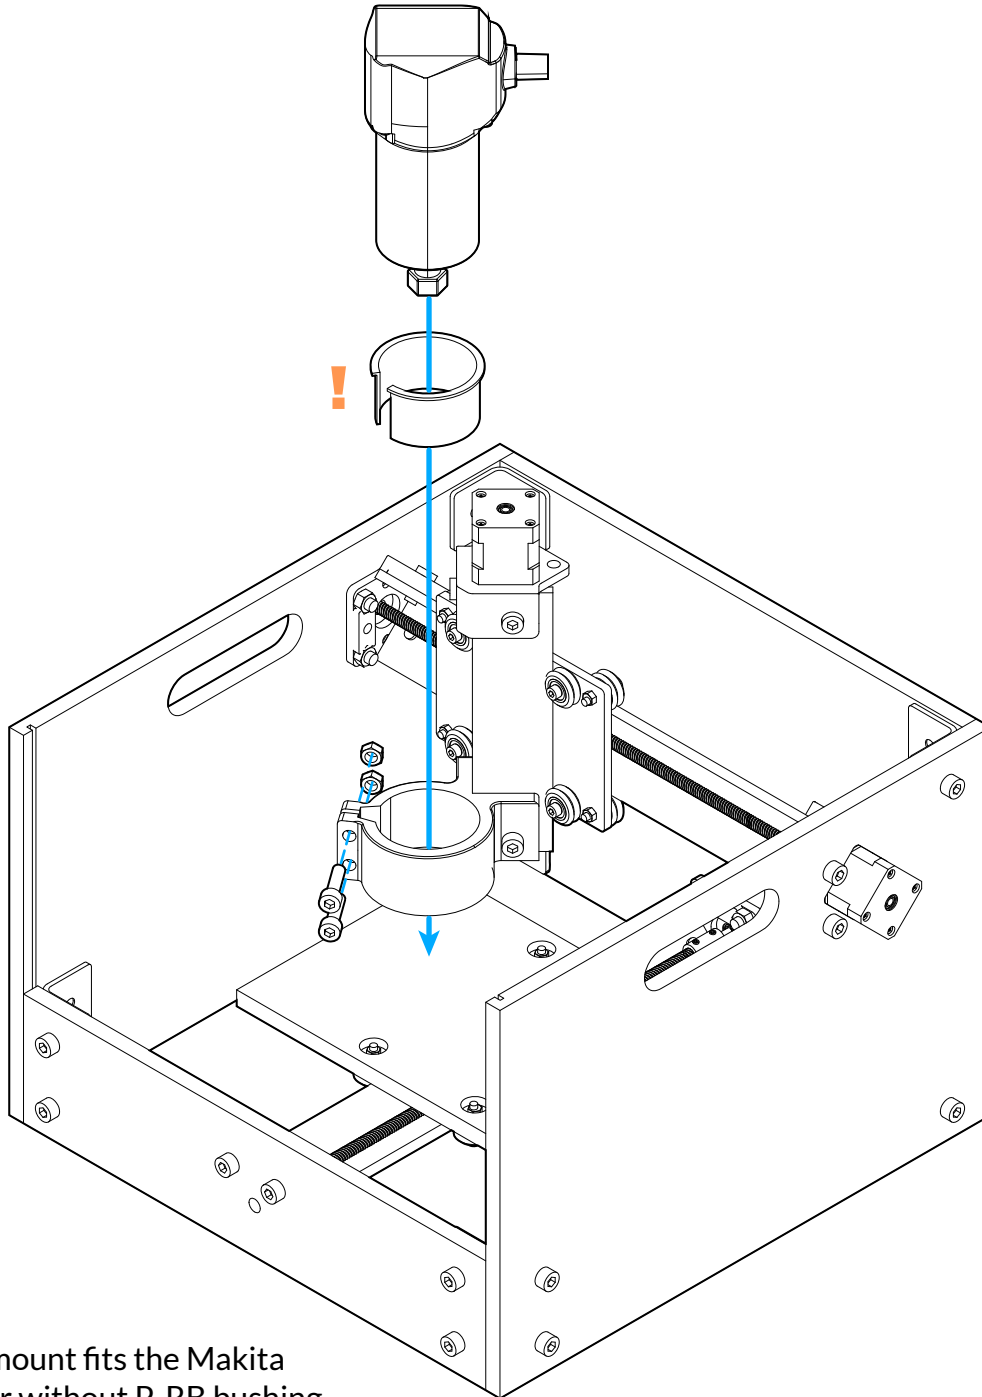


! P-RM router mount fits the Makita RT0701 router without P-RB bushing, bushing only required to mount Ridgid R24012 router





SIENCI LABS  
DESKTOP CNC MILLING

## STEP 23

Attaching  
Acrylic Shield

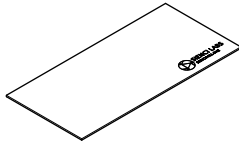


F-AC  
1x

 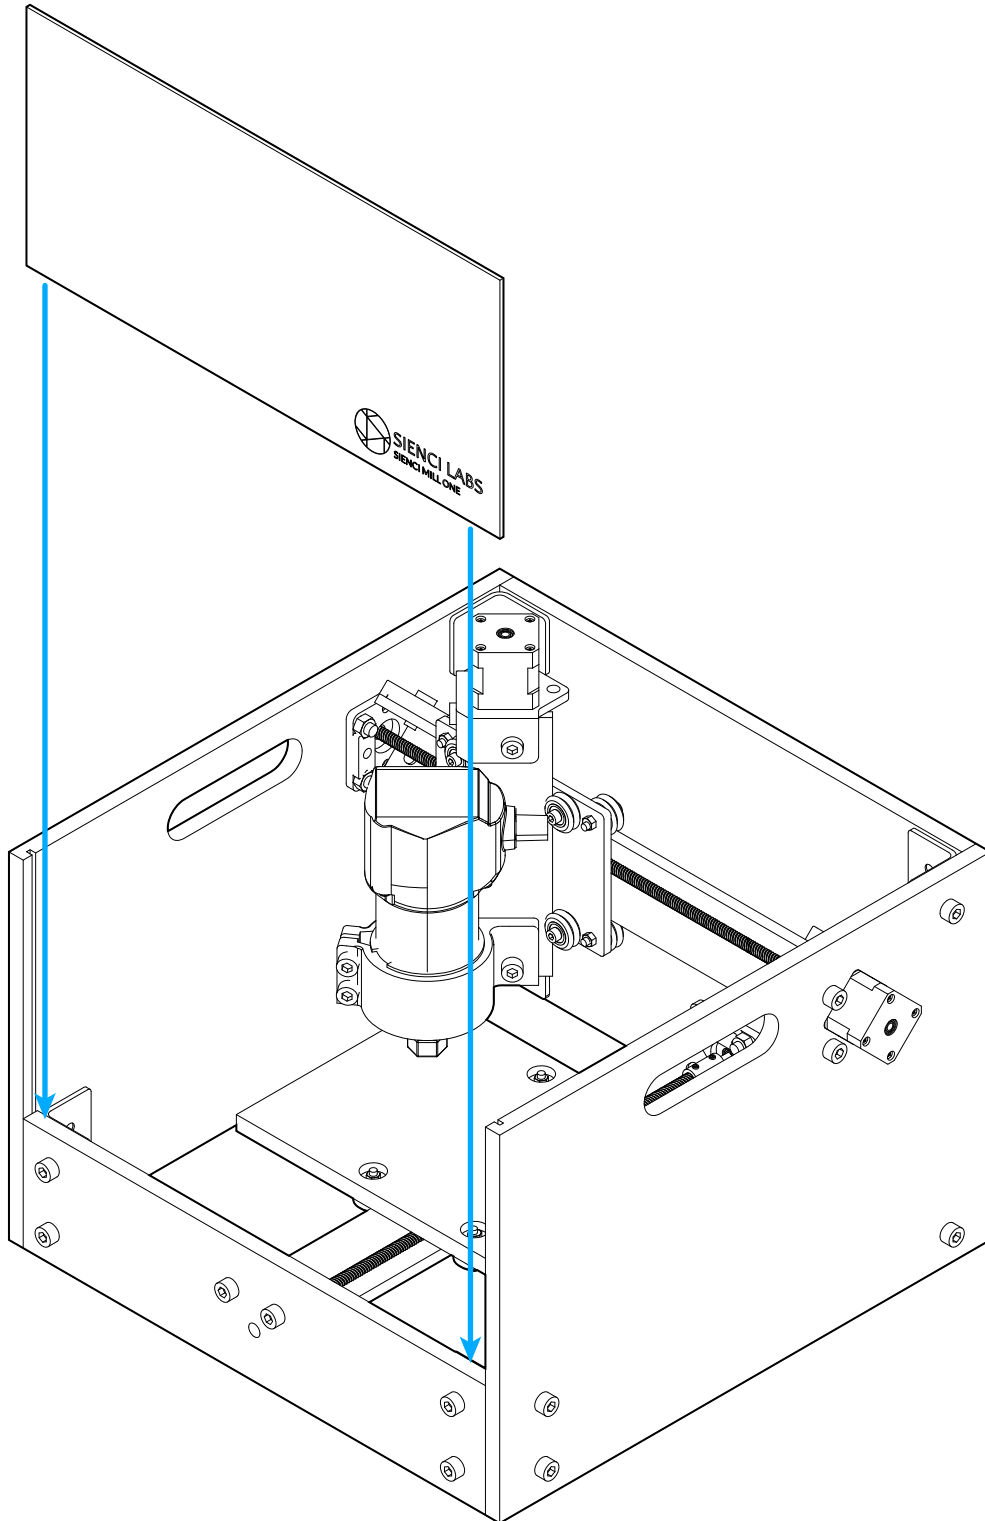


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 24


Combining the  
Arduino and  
CNC Shield

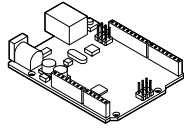

E-ARD  
**1x**

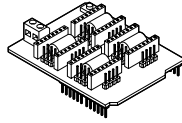

E-CNC  
**1x**

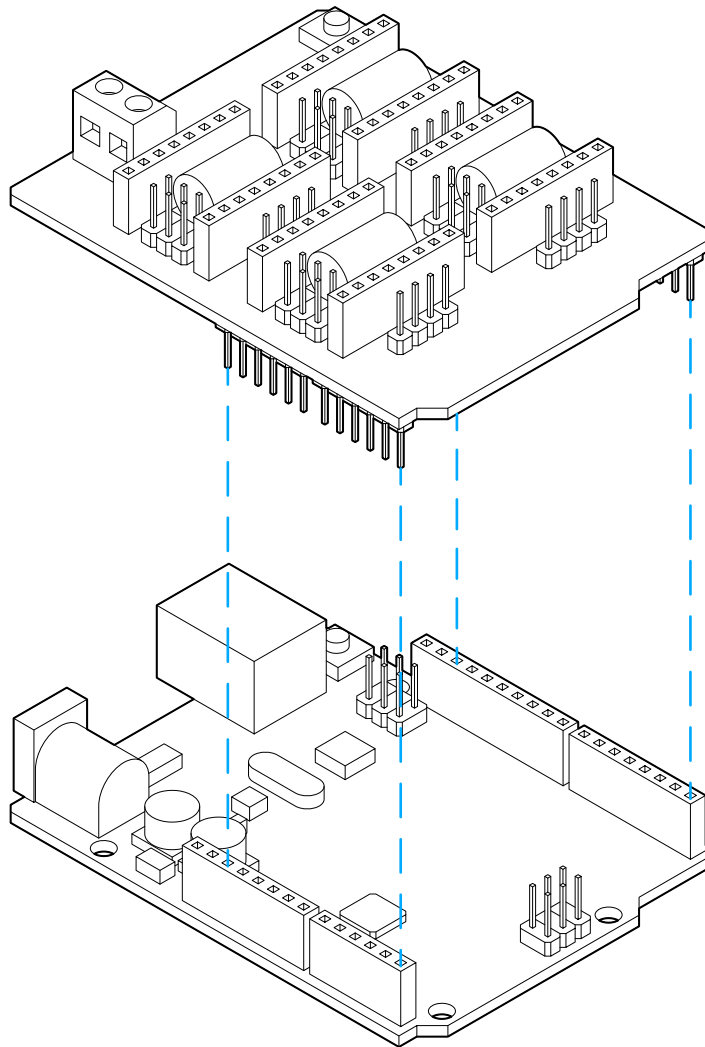


## STEP 25

Attaching the  
Header  
Jumpers




E-HJ  
**6x**

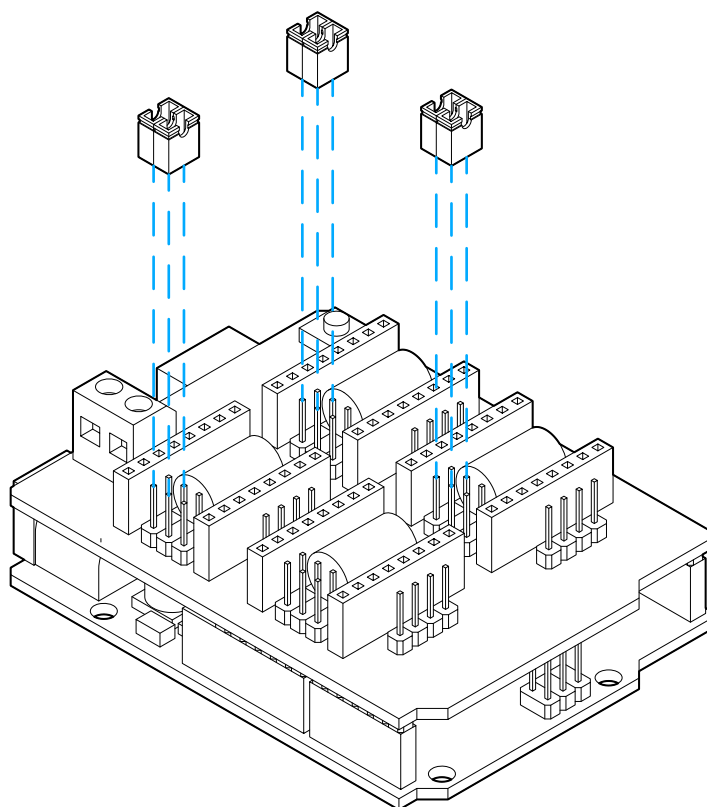


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 26

Attaching  
Motor Cables

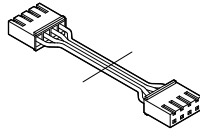

E-C  
3x

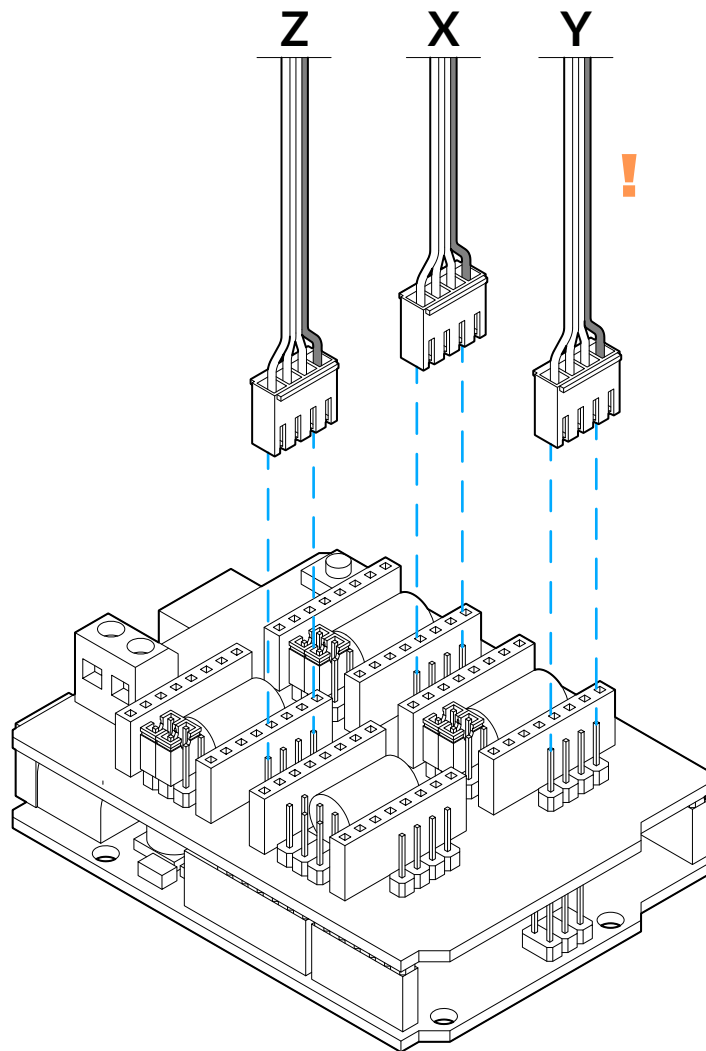


! Make sure the black wire is oriented as depicted

## STEP 27

 
Attaching  
Stepper Driver  
Chips




E-SDH  
**3x**





E-SDC  
**3x**

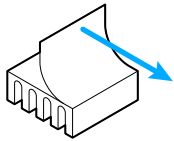

**3x**

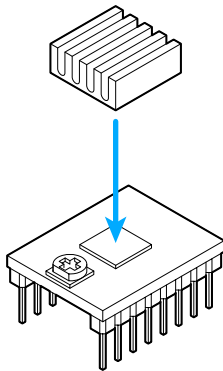

**3x**

 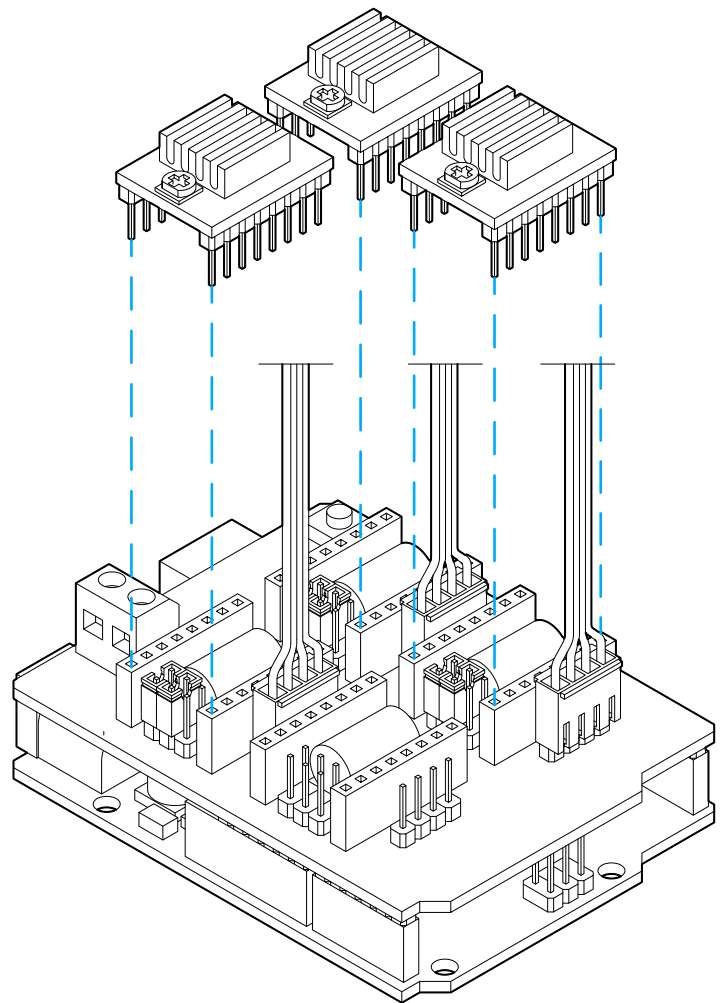


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 28



### Tuning the Stepper Motor Drivers



Phillips

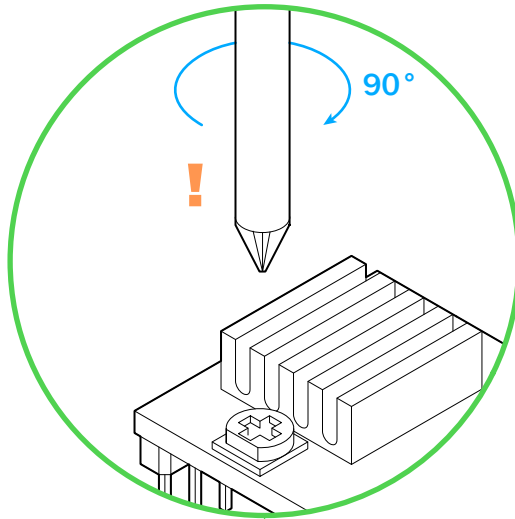


The stepper drivers should be tuned using the potentiometer on the front so that the flat edge on the dial faces to the left; this gives the stepper motors on the Mill One the right amount of power to run effectively. If further tuning is required, turning the flat either counterclockwise or clockwise will increase or decrease the motor power respectively.

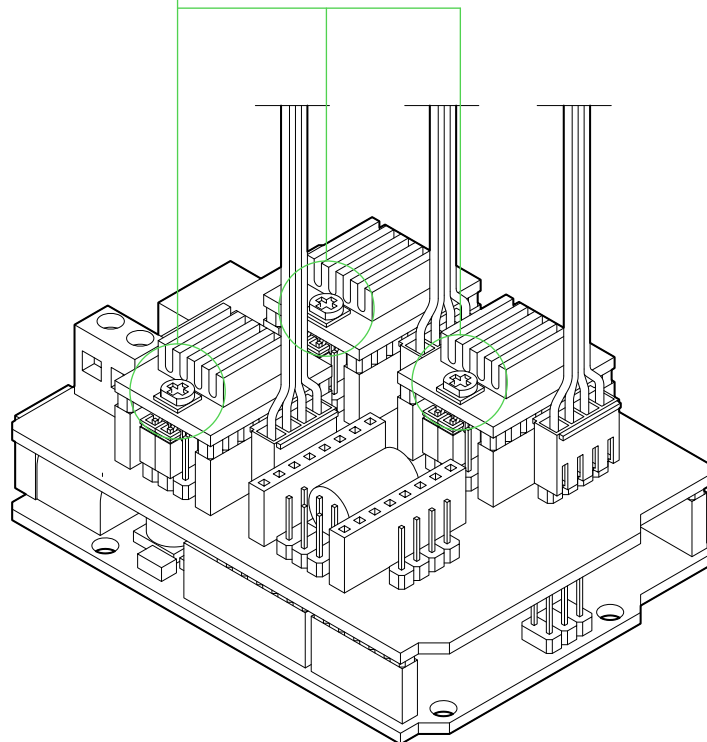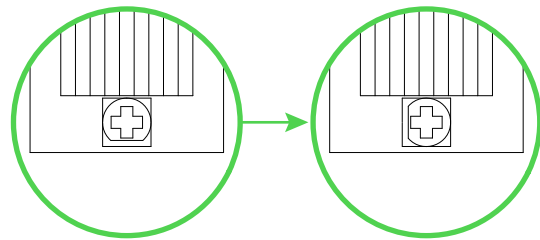


**!** Stepper driver potentiometers should never be turned while the board is powered up

## STEP 29

Placing Boards  
into Electronics  
Holder

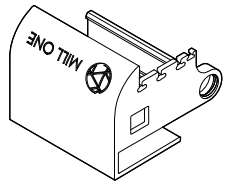


P-EH  
**1x**

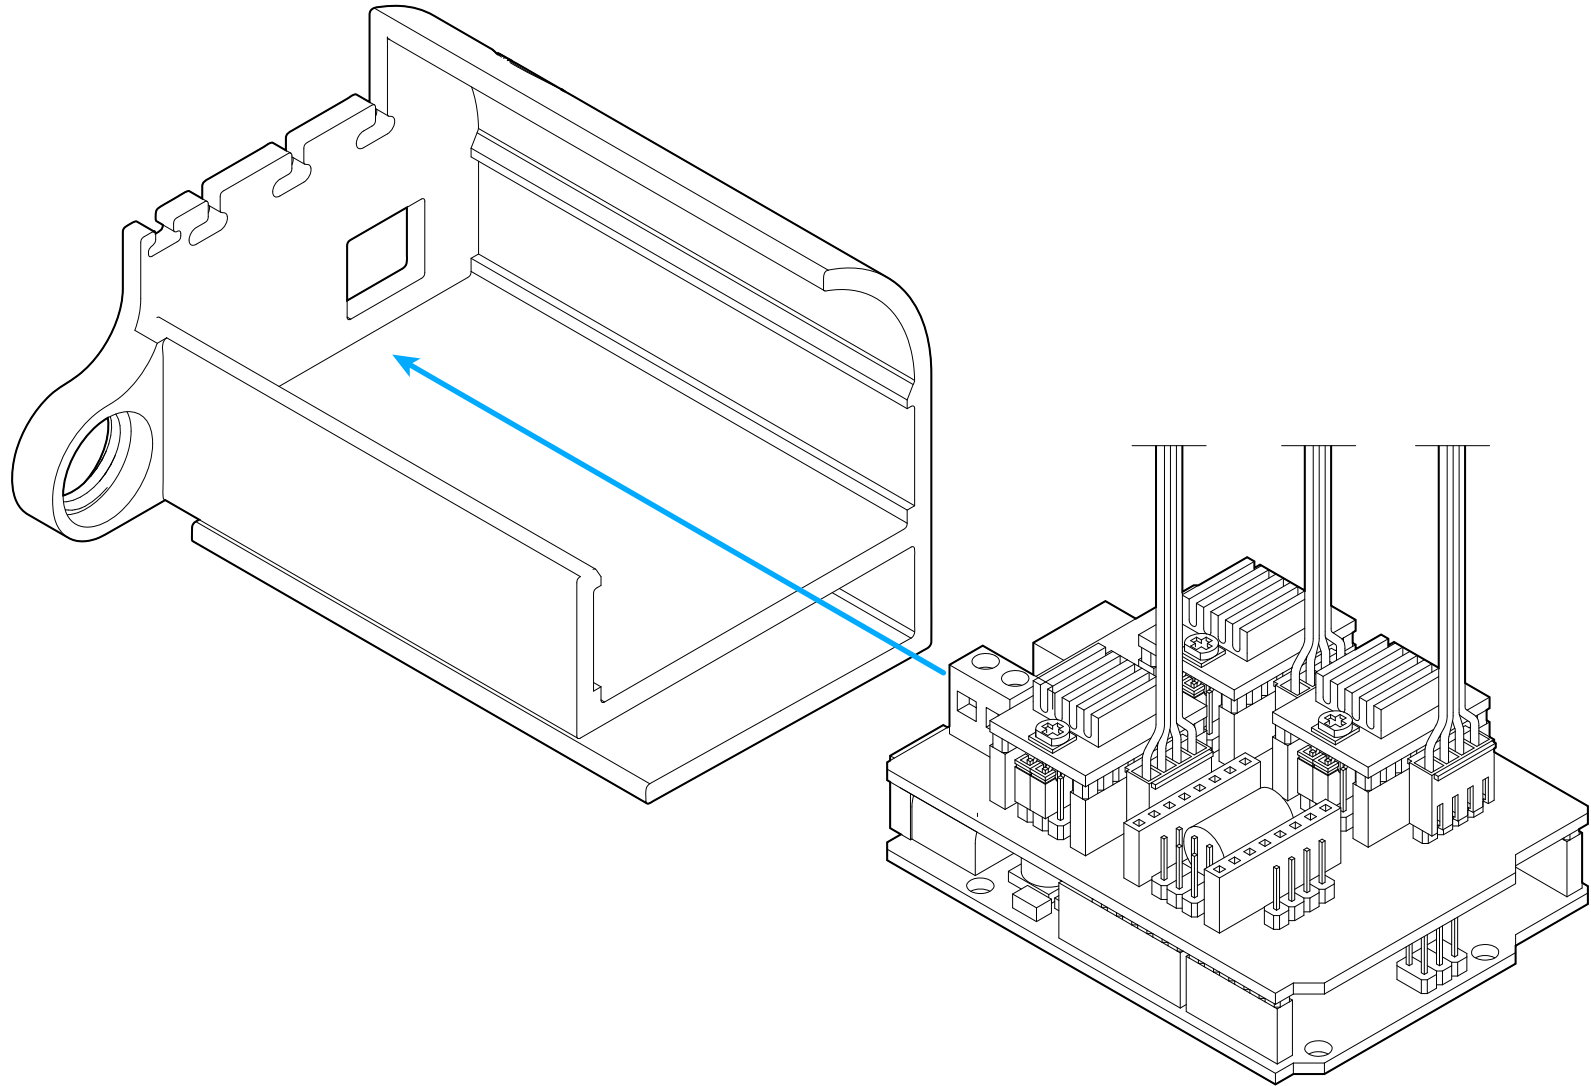




## STEP 30

Attaching  
DC Jack

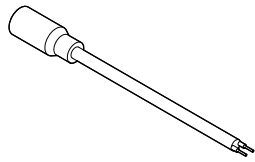

E-J  
1x

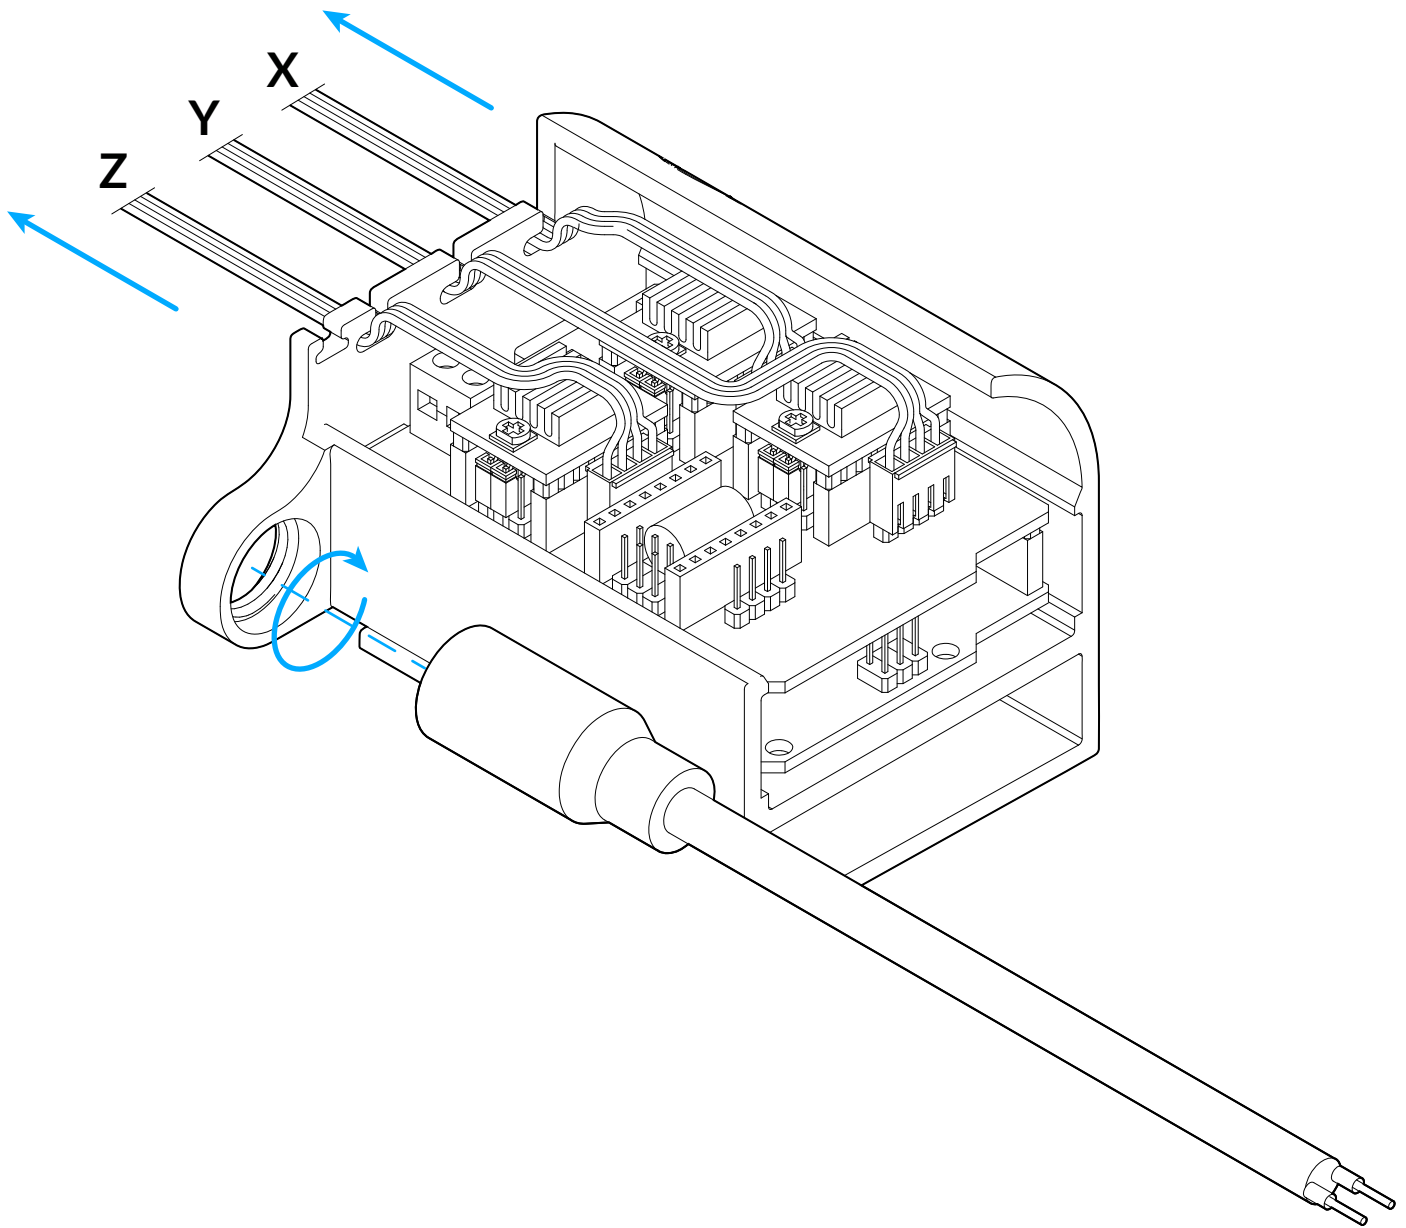


**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 31

Attaching  
DC Jack



Phillips

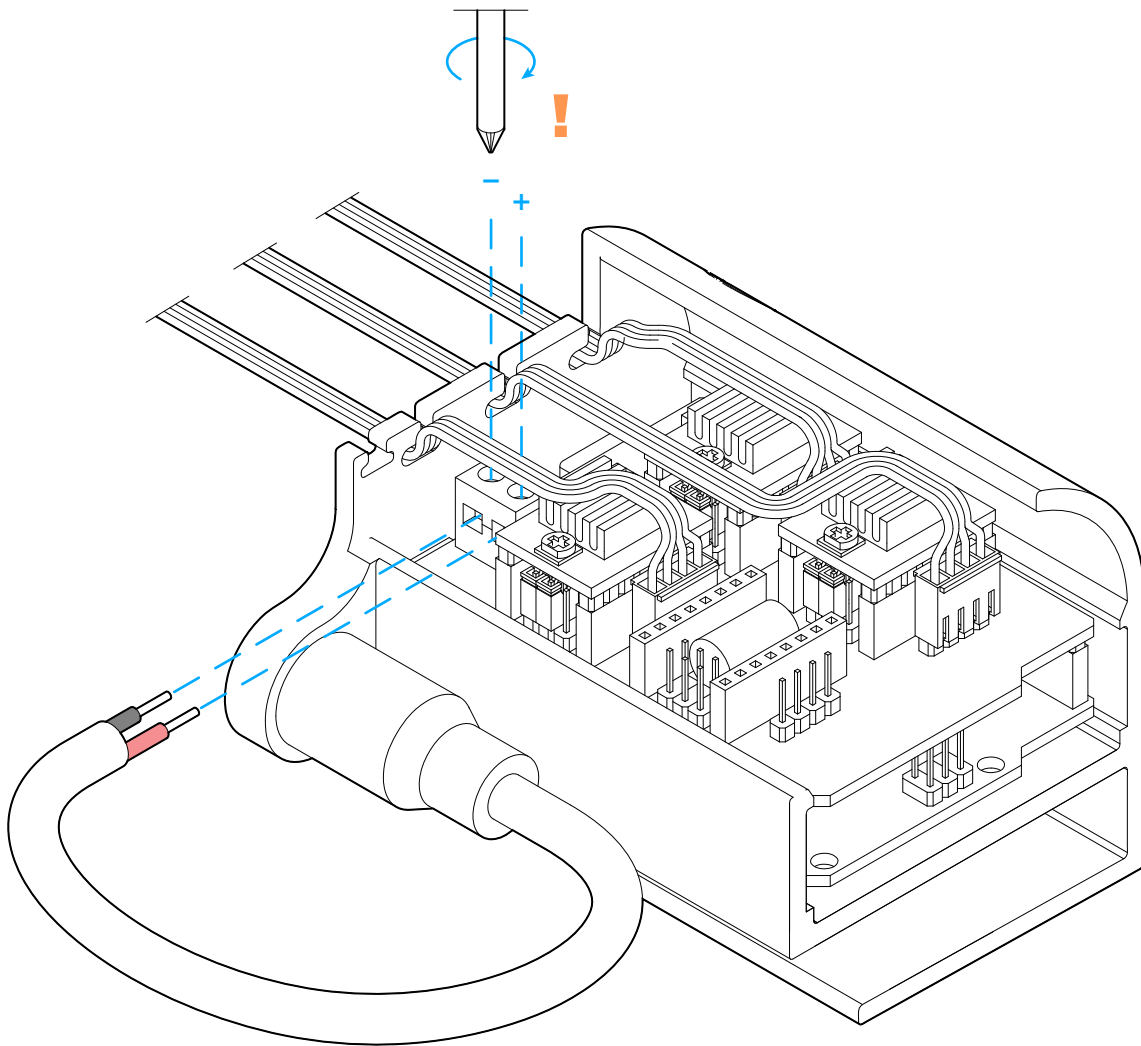


! Ensure polarity is correct to avoid damage to electronics




**SIENCI LABS**  
DESKTOP CNC MILLING

## STEP 32

Covering the  
Enclosure

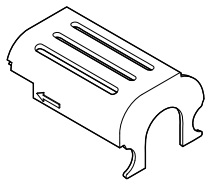


P-EC  
**1x**

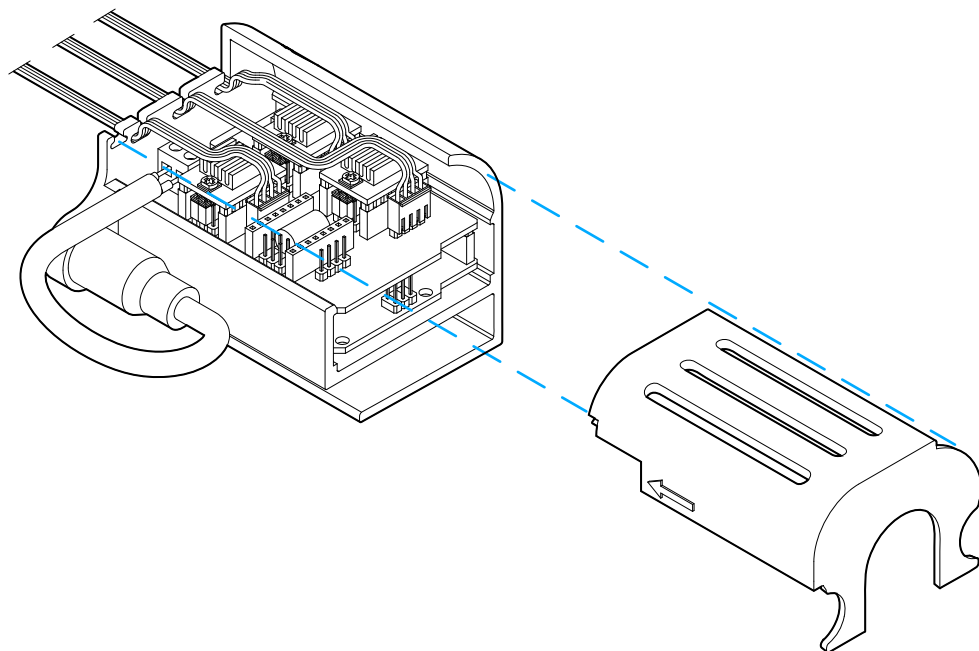

**SIENCI LABS**  
DESKTOP CNC MILLING


## STEP 33

Attaching  
Electronics to  
Motors

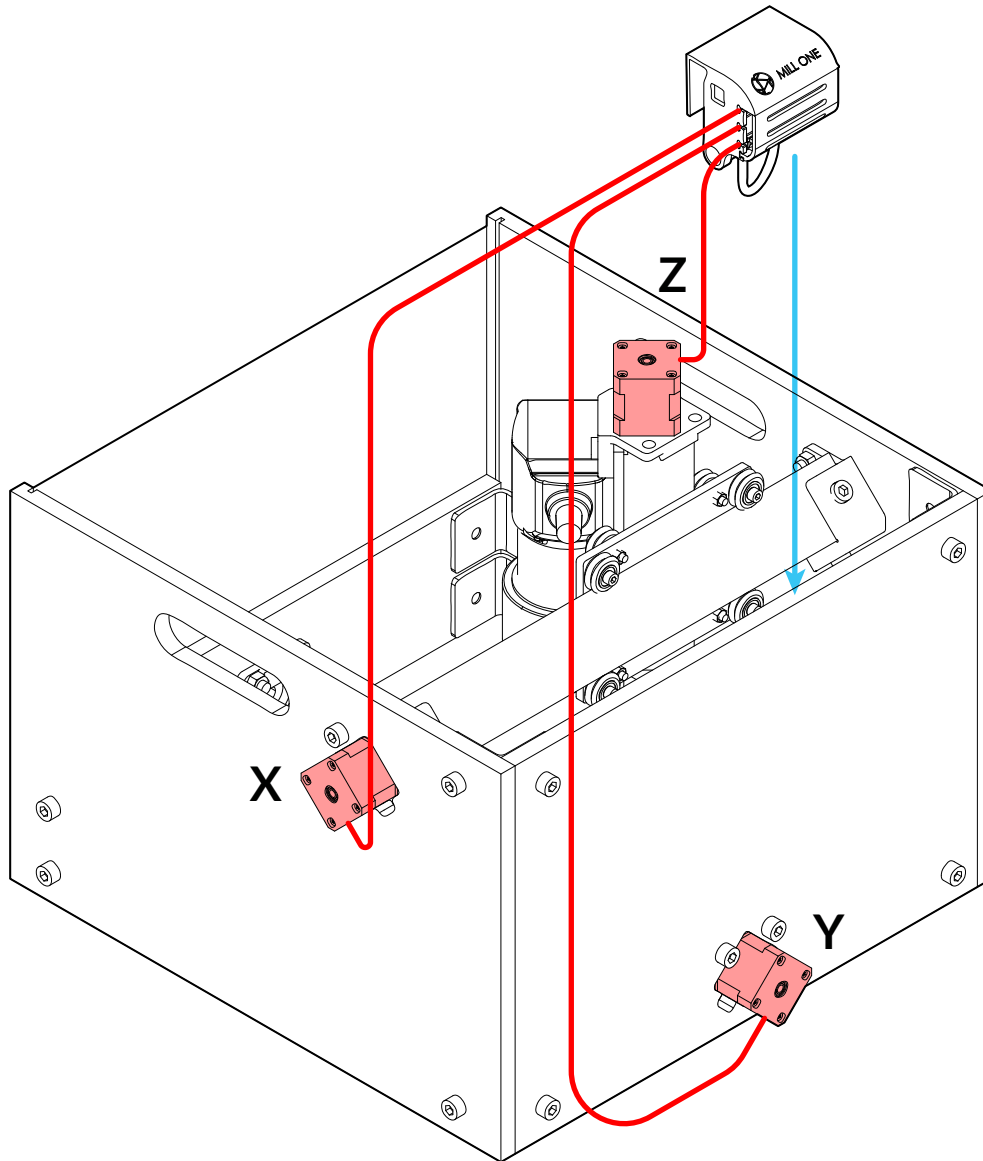


## STEP 34

Assembled  
Mill One

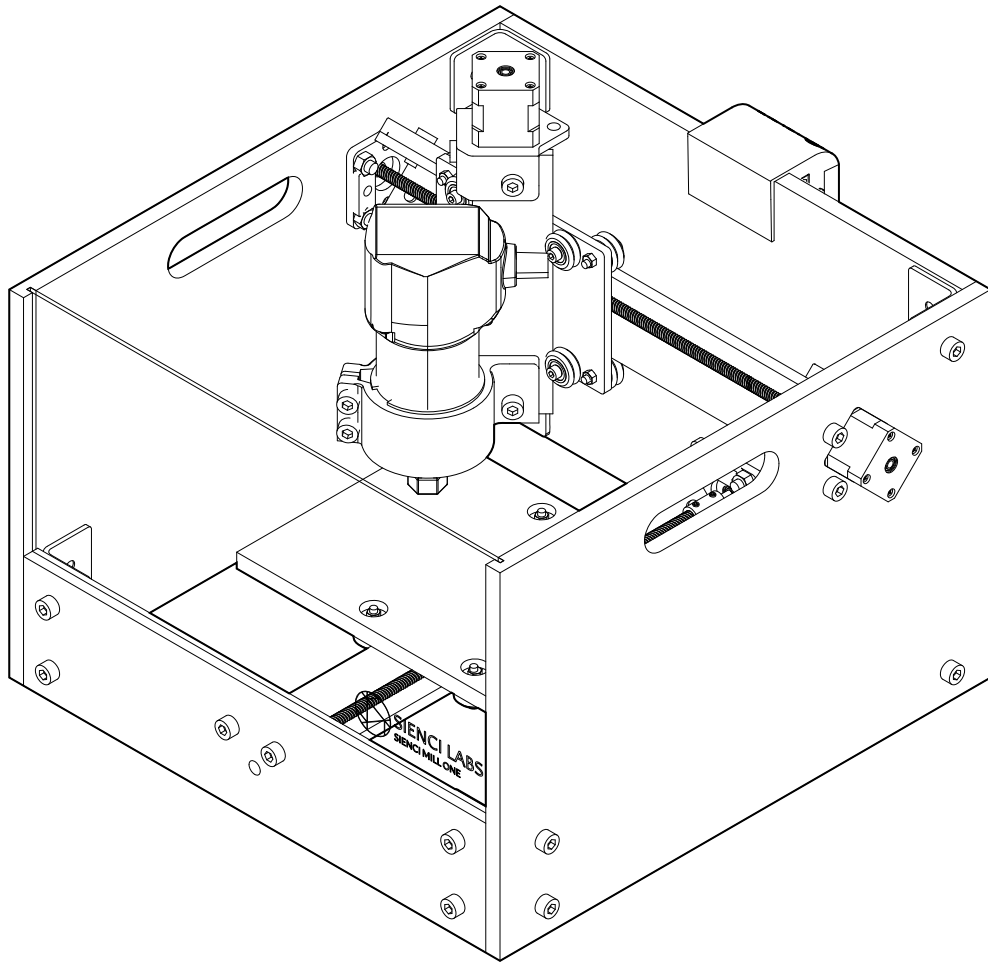

 Your Mill One is now fully assembled. Don't plug in your power brick yet, simply connect the USB cable to your computer and continue onto the next steps.



**SIENCI LABS**  
DESKTOP CNC MILLING